

AD-A156 444


NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS
MEREDITH RESERVOIR DA. (U) CORPS OF ENGINEERS WALTHAM
MA NEW ENGLAND DIV APR 79


1/1

UNCLASSIFIED

F/G 13/13

NL

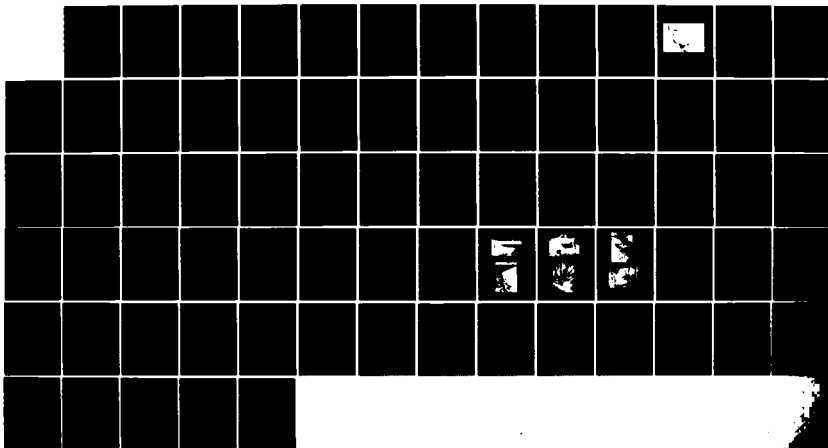

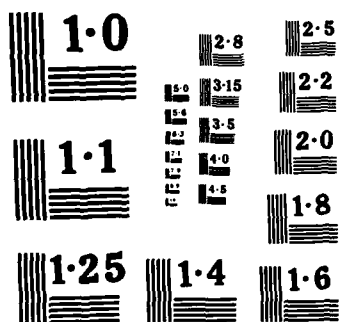

NATIONAL BUREAU OF STANDARDS
MICROCOPY RESOLUTION TEST CHART

AD-A156 444

MERRIMACK RIVER BASIN
MEREDITH NEW HAMPSHIRE

MEREDITH RESERVOIR DAM
N.H.00308

PHASE I INSPECTION REPORT
NATIONAL DAM INSPECTION PROGRAM



DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
WALTHAM, MASS. 02154

APRIL, 1979

DISTRIBUTION STATEMENT A

Approved for public release;
Distribution Unlimited

DTIC FILE COPY

85 06 17 014

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER NH 00308	2. GOVT ACCESSION NO. AD-A156444	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Meredith Reservoir Dam NATIONAL PROGRAM FOR INSPECTION OF NON-FEDERAL DAMS		5. TYPE OF REPORT & PERIOD COVERED INSPECTION REPORT
7. AUTHOR(s) U.S. ARMY CORPS OF ENGINEERS NEW ENGLAND DIVISION		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS DEPT. OF THE ARMY, CORPS OF ENGINEERS NEW ENGLAND DIVISION, NEDED 424 TRAPELO ROAD, WALTHAM, MA. 02254		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE April 1979
		13. NUMBER OF PAGES 45
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) APPROVAL FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES Cover program reads: Phase I Inspection Report, National Dam Inspection Program; however, the official title of the program is: National Program for Inspection of Non-Federal Dams; use cover date for date of report.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) DAMS, INSPECTION, DAM SAFETY, Merrimack Rvver Basin Meredith New Hampshire		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) Tce dam is an earthfill dam about 400 ft. long with a maximu height of 25 ft. The dam is small in size with a significatn hazard potential. The dam is judged to be in fair overall condition. Trees and brush are growing on the dam embankment and the spillway is showing signs of deterioration. It is recommended that a periodic annual technical inspection be implemented.		

DISCLAIMER NOTICE

**THIS DOCUMENT IS BEST QUALITY
PRACTICABLE. THE COPY FURNISHED
TO DTIC CONTAINED A SIGNIFICANT
NUMBER OF PAGES WHICH DO NOT
REPRODUCE LEGIBLY.**

MEREDITH RESERVOIR DAM

NH 00308

MEREDITH, NEW HAMPSHIRE

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input checked="" type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A/1	23 GAY



PHASE I INSPECTION REPORT

NATIONAL DAM INSPECTION PROGRAM

NATIONAL DAM INSPECTION PROGRAM
PHASE I INSPECTION REPORT

Identification No: NH 00308
Name of Dam: Meredith Reservoir Dam
Town: Meredith
County and State: Belknap County, New Hampshire
Stream: Unnamed
Date of Inspection: November 13, 1978

BRIEF ASSESSMENT

The Meredith Reservoir Dam is an earthfill dam approximately 400 feet long with a maximum height of 25 feet. The dam is presently used as a pump/storage reservoir for the Town's water supply system. Water is pumped to the reservoir from Lake Waukegan and let down to the supply system only during emergency conditions. The dam has a 0.17 square mile drainage area and a normal impoundment of 15 acre-feet.

Based on a size classification of small and a significant hazard category, in accordance with the "Recommended Guidelines for Safety Inspection of Dams, Department of the Army 1976," the test flood for this dam is one-half the probable maximum flood (1/2 PMF). The routed test flood outflow of 381 CFS overtops the dam by 0.2 feet. The spillway capacity of 318 CFS is 83 percent of the test flood.



The dam is judged to be in fair overall condition. The following conditions were noted as possible future problems:

1. Trees and brush are growing on the dam embankment.
2. The spillway is showing signs of deterioration.
3. A wet area was found at the base of the dam.

It is recommended that a periodic annual technical inspection program be implemented within one year of the receipt of this report containing the following:

1. Remove trees and brush on a yearly basis.
2. Inspect the downstream slope of the dam for seepage on a yearly basis.
3. Inspect the spillway every two years.

4. Maintain all gates in operational condition.
5. Inspect the upstream embankment at low water conditions.
6. Establish a formal warning system.

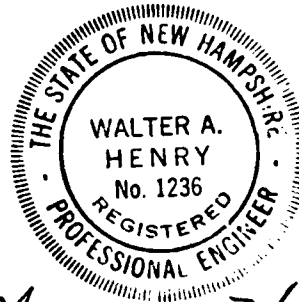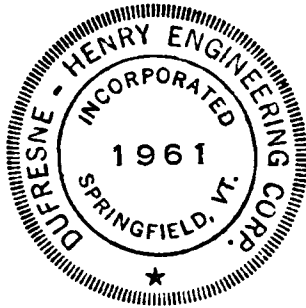

Walter A. Henry

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation, and analyses involving topographic mapping, subsurface investigations, testing and detailed computational evaluations are beyond the scope of a Phase I Investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through continued care and inspection can there be any chance that unsafe conditions be detected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test Flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aid in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

TABLE OF CONTENTS

<u>Section</u>	<u>Page</u>
Letter of Transmittal	
Brief Assessment	
Review Board Page	
Preface	i
Table of Contents	ii-iv
Overview Photo	v
Location Map	vi

REPORT

1. PROJECT INFORMATION

1.1 General	1-1
a. Authority	1-1
b. Purpose	1-1
1.2 Description of Project	1-1
a. Location	1-1
b. Description of Dam and Appurtenances	1-1
c. Size Classification	1-2
d. Hazard Classification	1-2
e. Ownership	1-2
f. Operator	1-2
g. Purpose	1-3
h. Design and Construction History	1-3
i. Normal Operation Procedures	1-3
1.3 Pertinent Data	1-3
a. Drainage	1-3
b. Discharge at the Dam Site	1-3
c. Elevations	1-4
d. Reservoir	1-5
e. Storage	1-5
f. Reservoir Surface	1-5
g. Dam	1-6
h. Diversion and Regulating Tunnel	1-6
i. Spillway	1-6
j. Regulating Outlets	1-7

Section


Page

7. ASSESSMENT, RECOMMENDATIONS AND REMEDIAL MEASURES


7.1	Dam Assessment	7-1
a.	Condition	7-1
b.	Adequacy of Information	7-1
c.	Urgency	7-1
d.	Need for Additional Investigations	7-1
7.2	Recommendations	7-1
7.3	Remedial Measures	7-1
a.	Operation and Maintenance Procedures	7-1
7.4	Alternatives	7-1

APPENDICES

APPENDIX A - VISUAL INSPECTION CHECK LIST	A-1
APPENDIX B - PROJECT RECORDS AND PLANS	B-1
APPENDIX C - PHOTOGRAPHS	C-1
APPENDIX D - HYDROLOGIC AND HYDRAULIC COMPUTATIONS	D-1
APPENDIX E - INFORMATION AS CONTAINED IN THE NATIONAL INVENTORY OF DAMS	E-1

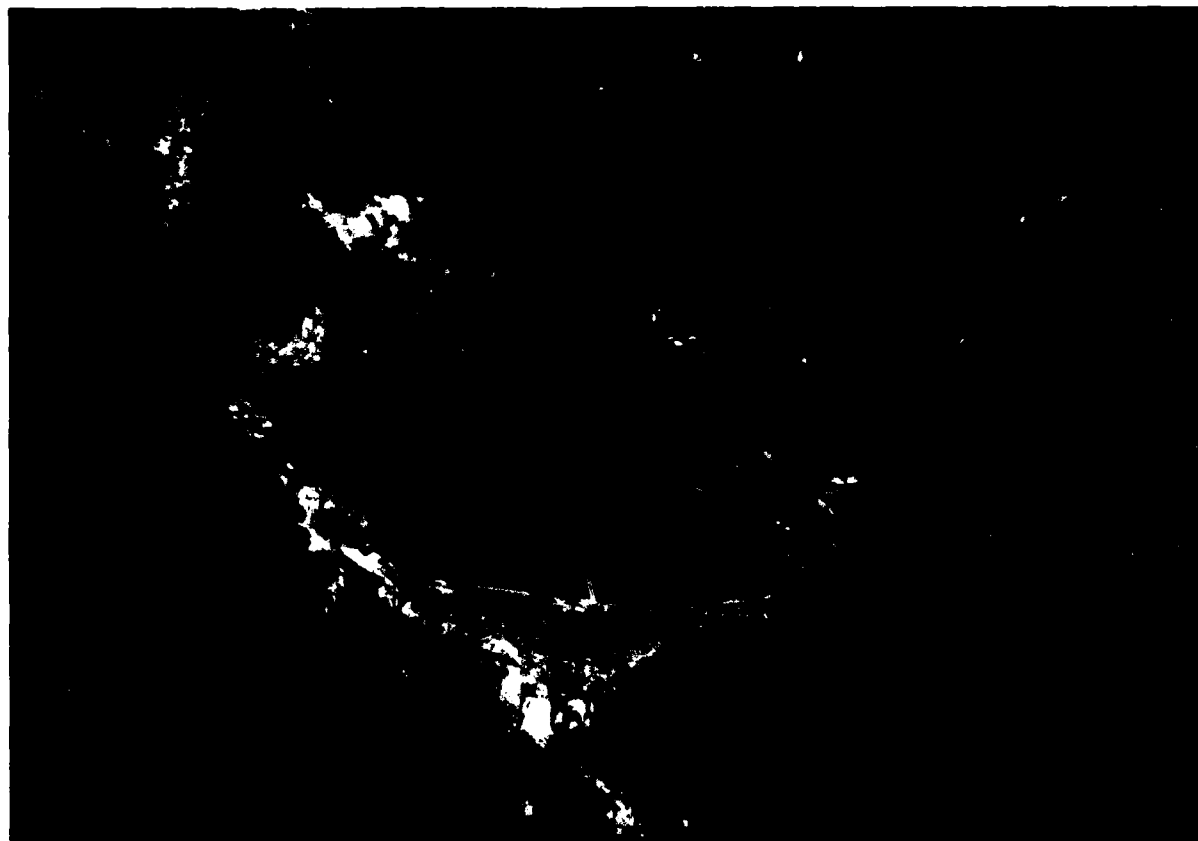

OVERVIEW OF
MEREDITH RESERVOIR DAM
MEREDITH, NEW HAMPSHIRE

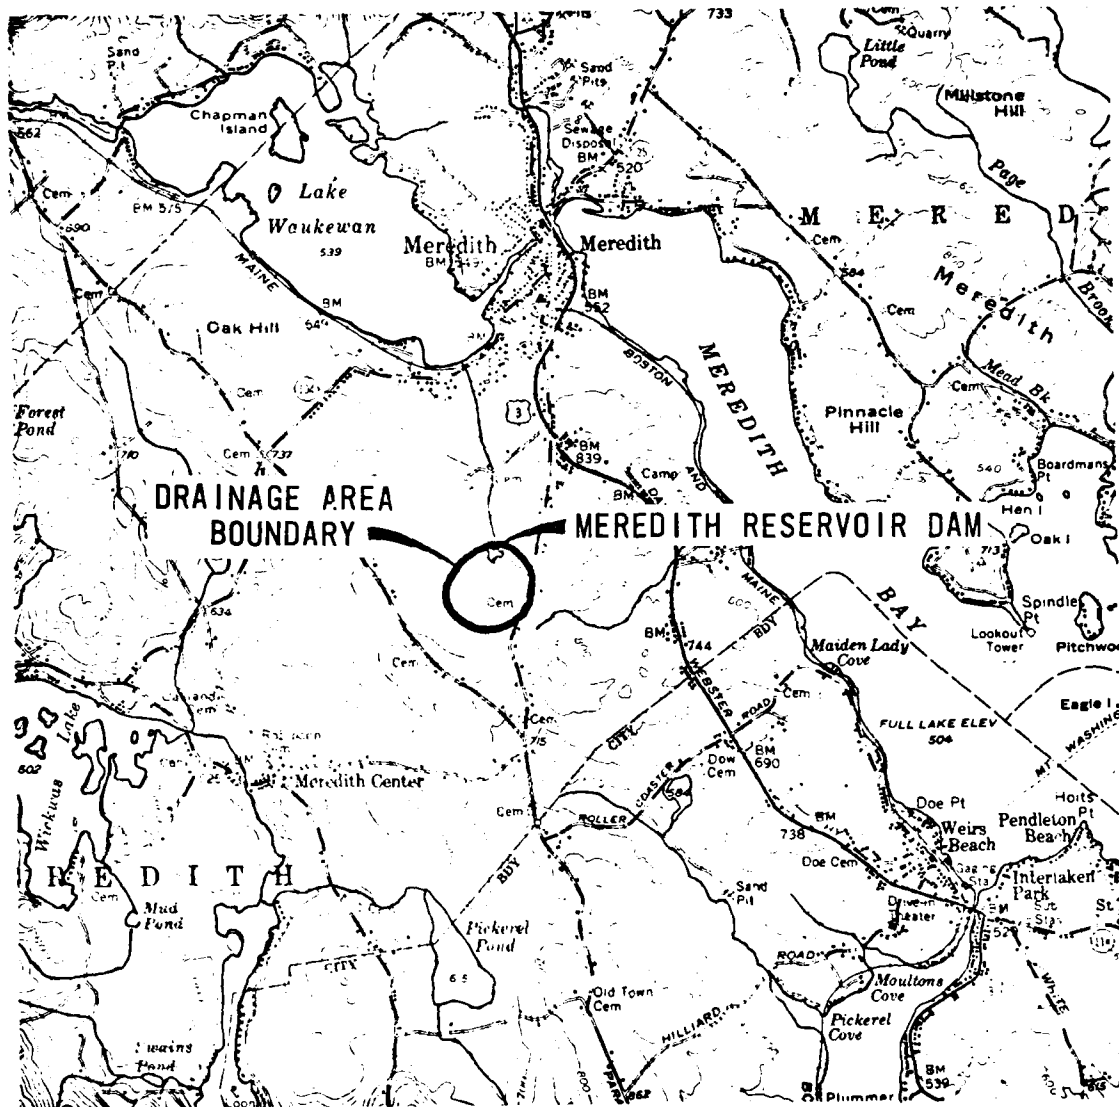

SOURCE OF MAP:
U.S. GEOLOGICAL SURVEY
HOLDerness & WINNIPESAUKEE
QUADRANGLES
NEW HAMPSHIRE
SERIES V712
1:62500 1956

DUFRESNE-HENRY ENGINEERING CORP.
ARCHITECT-ENGINEER

U.S. ARMY ENGINEER DIV. NEW ENGLAND
CORPS OF ENGINEERS
WALTHAM, MASS.

NATIONAL PROGRAM OF INSPECTION OF NON-FED. DAMS

LOCATION MAP MEREDITH RESERVOIR DAM

MEREDITH

NEW HAMPSHIRE

CLIENT NO 04-0082
ENGR JAD

SCALE 1" = 1 MILE
DATE 3-14-79

NATIONAL DAM INSPECTION PROGRAM
PHASE I INSPECTION REPORT
NAME OF DAM: MEREDITH RESERVOIR

SECTION 1 - PROJECT INFORMATION

1.1 General

a. Authority

Public Law 92-367, August 8, 1972, authorized the Secretary of the Army, through the Corps of Engineers, to initiate a National Program of Dam Inspection throughout the United States. The New England Division of the Corps of Engineers has been assigned the responsibility of supervising the inspection of dams within the New England Region. Dufresne-Henry Engineering Corporation has been retained by the New England Division to inspect and report on selected dams in the State of New Hampshire. Authorization and notice to proceed were issued to Dufresne-Henry Engineering Corporation under a letter of November 20, 1978 from Max B. Scheider, Colonel, Corps of Engineers. Contract No. DACW33-79-C-0010 has been assigned by the Corps of Engineers for this work.

b. Purpose

- (1) Perform technical inspection and evaluation of non-federal dams to identify conditions which threaten the public safety and thus permit correction in a timely manner by nonfederal interests.
- (2) Encourage and prepare the states to initiate quickly effective dam safety programs for nonfederal dams.
- (3) To update, verify and complete the National Inventory of Dams.

1.2 Description of Project

a. Location

The Meredith Reservoir Dam is located in central New Hampshire in the Town of Meredith, Belknap County, and is in the Merrimack-Winnepesaukee basin.

b. Description of Dam and Appurtenances

Meredith Reservoir Dam is an earth fill dam, approximately 400 feet long and has a maximum height of 25 feet. The reservoir was originally actively utilized as a water supply source for

the Town of Meredith. The Town has recently developed alternate supply sources and the reservoir is only used during emergency conditions. A control tower located approximately 30 feet from the upstream face of the dam houses the potable water intake facilities and reservoir drain valve.

The maximum reservoir level is controlled by a concrete and stone spillway structure. A channel has been constructed to convey any overflow around the dam and into the natural streambed. A vehicle service bridge spans the outlet channel approximately 15 feet downstream of the spillway crest.

c. Size Classification

The Meredith Reservoir Dam has a maximum height of 25 feet and a maximum storage volume of 28 acre-feet. The USCE Guidelines place dams with maximum heights between 25 and 40 feet and maximum storage less than 50 acre-feet in the small category. Therefore, the size classification of the Meredith Dam is small.

d. Hazard Classification

A failure of the Meredith Dam Reservoir would route a flood wave into a relatively small natural channel with extensive overbank flow. Approximately 2000 feet downstream the flood wave would encounter a culvert under Reservoir Road and a single family dwelling on the banks of the stream, resulting in considerable damage and possible loss of life. Thus, in accordance with USCE Guidelines, the hazard classification is significant.

e. Ownership

The present owner of the Meredith Reservoir Dam is:

Meredith Fire District
Town of Meredith
Meredith, New Hampshire 03253

f. Operator

The reservoir is operated by the:

Meredith Fire District
Meredith, New Hampshire 03253

Telephone 603-279-4537

g. Purpose

The reservoir is part of the Town of Meredith's water supply system. At the present time the reservoir is used to store water for emergency purposes. Water is pumped from Lake Waukewan, stored in the reservoir and used as needed in emergency situations. Because of the limited drainage area of 0.17 square miles, the yield for water supply is minimal.

h. Design and Construction History

Little information is available concerning the design and construction of the Meredith Reservoir Dam. Previous inspection data indicates an original construction date prior to 1934. Subsequent construction activity disclosed by the inspection includes minor concrete facing of portions of the stone spillway walls and a gunite facing of the control tower foundation. The exact dates of these construction repairs is not known.

i. Normal Operation Procedure

In recent years, a pumping station was constructed along the reservoir transmission line approximately 0.4 miles downstream of the reservoir. The flow from the reservoir is controlled at this location, with the valve at the reservoir control tower remaining open. As mentioned previously, the reservoir is used only in emergency situations.

1.3 Pertinent Data

a. Drainage

The drainage area to the Meredith Reservoir is a relatively small 0.17 square miles and consists of gently rolling hills and open fields. There are no significant channels upstream of the dam. A diversion ditch and pipeline have been constructed upstream of the reservoir in the northeast portion of the drainage basin. From the topography of the area it appears that the purpose of the diversion was to prevent undesirable runoff and possible contamination from reaching the reservoir from an upstream pasture which may have contained manure or fertilizer.

b. Discharge at the Dam Site

(1) Outlet Works

There are two outlets for the Meredith Reservoir, a pipeline connected to the Town's municipal water system and an overflow spillway. The pipeline is actually

both an inlet and an outlet because of the pump-storage operation. The stored water is only utilized under emergency conditions.

The total capacity of the spillway with the water level at the top of the training walls is 418 CFS. The low point in the earth dam, however, is one foot lower than the top of the training walls thus reducing the actual capacity to 318 CFS.

(2) Maximum Known Flood at Dam Site

No records or recollections of any flooding were found during the investigations.

(3) Spillway Capacity

318 CFS.

c. Elevations (Based on an assumed bench mark elevation of 100.0, see plan for T.B.M. location.)

(1) Streambed at Centerline of Dam

75 \pm .

(2) Maximum Tailwater

Not applicable.

(3) Upstream Portal Invert

Not applicable.

(4) Recreation Pool (at time of inspection)

94.5.

(5) Full Flood Control Pool

Not applicable.

(6) Spillway Crest

95.8.

(7) Design Surcharge

Not known.

(8) Top of Dam (Minimum)

99.6.

(9) Test Flood Surcharge

99.8

d. Reservoir

(1) Length of Maximum Pool

400 feet \pm

(2) Length of Recreation Pool

400 feet \pm

(3) Length of Flood Control Pool

400 feet \pm

e. Storage

(1) Recreation Pool

15 acre-feet.

(2) Flood Control Pool

Not applicable.

(3) Test Flood Pool

28 acre-feet.

(4) Spillway Crest Pool

15 acre-feet.

(5) Top of Dam

27.6 acre-feet.

f. Reservoir Surface

(1) Top of Dam

3 acres.

(2) Test Flood Pool

3 acres.

(3) Recreation Pool

3 acres.

(4) Spillway Crest

3 acres.

g. Dam

(1) Type

Earth dam.

(2) Length

400 feet (approximately).

(3) Height

25 feet (maximum).

(4) Top Width

15 feet \pm

(5) Side Slopes

Upstream: 1.0H to 1.0V.

Downstream: 1.5H to 1.0V.

(6) Zoning

None known.

(7) Impervious Core

None known.

(8) Cutoff

None known.

(9) Grout Curtain

None known.

h. Diversion and Regulating Tunnel

Not applicable.

i. Spillway

The overflow spillway has a triangular concrete crest with stone training walls and a crest elevation of 95.8. The spillway width is 14.3 feet and maximum height is 4.2 feet.

An earth spillway channel has been constructed downstream of the spillway, routing the overflow to the original channel without endangering the earth portions of the dam. The channel is approximately 20 feet wide by 3 feet deep.

j. Regulating Outlets

The valves located in the valve house at the dam have not been routinely maintained and operated. There was evidence in the form of wrench teeth marks on the operating stems indicating that undue force is necessary to adjust the valves. The present control of water to and from the dam is at the new pumping station 1800 feet downstream of the dam.

SECTION 2 - ENGINEERING DATA

2.1 Design

There is no design data available for this dam.

2.2 Construction

There is no information on the construction other than an approximate construction date prior to 1934.

2.3 Operation

The Meredith Reservoir is currently being operated as a pump storage reservoir. Water is pumped from Lake Waukegan and stored at the reservoir for emergency situations. All operations take place at the new pumping station and there is no physical operation at the dam.

2.4 Evaluation

a. Availability

The design and construction records for this dam are not available.

b. Adequacy

The lack of in-depth engineering data does not allow for a definitive review. Therefore, the adequacy of the evaluation cannot be based on a review of design calculations but on the visual inspection, past performance history and sound hydrologic and hydraulic engineering judgment.

c. Validity

Not applicable.

SECTION 3 - VISUAL INSPECTION

3.1 Findings

a. General

The on-site inspection of the Meredith Reservoir Dam was performed on November 13, 1978. The water level at the time of inspection was approximately 1.3 feet below the spillway crest. No emergency conditions were observed on the day of the inspection.

b. Dam Embankment

The dam embankment is in generally good condition. Some evidence of seepage was found just downstream of the toe at the highest section of the dam. The area was damp with some depressions filled with standing water. A marsh-type vegetation indicates that the area is permanently wet and thus the condition is ground water or seepage related rather than trapped surface runoff.

The top and downstream slope of the dam are covered with grass and brush. There are numerous tree stumps on the downstream slope. Several large trees are located on both sides of the spillway. The root systems of at least one of these trees appears to be in the dam embankment on the downstream slope.

The downstream slope is approximately 1.5H:1V, while the upstream slope is somewhat steeper at 1H:1V. The water level at the time of inspection was approximately 1.3 feet below the spillway crest and therefore a complete visual inspection of the upstream slope could not be performed. The upper portion which could be viewed indicated a uniform riprap facing which was in good condition.

c. Appurtenant Structures

(1) Control Tower and Service Bridge

The control tower is located approximately 30 feet from the upstream dam embankment and is connected to the embankment via a steel girder service bridge. The control tower and service bridge are in good condition with the exception of the bridge abutment at the dam embankment which has settled and cracked (see Photo 9). The control tower concrete foundation received a 6-inch gunite coating in recent years.

The main floor of the control tower houses six hand wheel valve operators and a reservoir level indicator (see Photo 8). The valves are located below the water level and the function of each respective valve could not be determined by a visual inspection. The valve operator shafts showed signs of excessive force applied with a pipe wrench during valve operation. It could not be determined at the time of inspection if the valves were operational. One of the valves is assumed to be a drain valve. The outlet of the drain conduit was located but the size or material of the conduit could not be determined. The drain conduit discharges to a stone masonry culvert which enters the natural channel downstream of the service road (see site plan).

(2) Spillway

The original spillway was constructed with concrete crest and apron, and stone masonry training walls. A steel girder vehicle bridge spans the spillway channel approximately 15 feet downstream of the crest. At some time subsequent to original construction a concrete facing was applied to the upstream ends of the stone masonry training walls.

The concrete sections of the spillway structures are in poor condition. Most of the concrete is either cracked or spalled with major spalling occurring on the left training wall facing. There were no signs of significant leakage through the spillway structure during inspection, but leakage may be present during higher water levels.

The stone masonry training walls were in fair to poor condition with very little of the original mortar remaining. Several stones on the downstream end of the walls have fallen into the channel due to erosion of the channel banks.

A 12-inch clay tile drain outlet was found at the downstream end of the right training wall. The drain was traced to a surface inlet and diversion ditch on the upstream side of the reservoir. It is assumed that the drain was used to divert undesirable runoff around the potable water reservoir. Approximately 1/4-inch of clear flow was flowing at the drain outlet while no water was found at the inlet. The origin of this flow is unknown.

d. Reservoir Area

The reservoir area was found to be in good condition. The banks are covered with grass and small brush. There are no

overhanging trees, floating debris or other sources of possible spillway obstructions.

e. Downstream Channel

The original streambed that constitutes the downstream channel had very little flow at the time of inspection. The channel is a typical stream channel flowing through a heavily wooded area.

The spillway overflow channel is a manmade channel approximately 20 feet wide by 3 feet deep (see Photo 10). The banks of the channel are overgrown with small trees and brush and there is no evidence of any recent flow.

SECTION 4 - OPERATIONAL PROCEDURES

4.1 Procedures

None.

4.2 Maintenance of Dam

At the present time there is no scheduled maintenance program for the dam. Several trees were removed recently from the area downstream of the dam embankment as required by the Water Resources Board subsequent to their August 15, 1975 inspection.

4.3 Maintenance of Operating Facilities

The operating facilities at the dam are not maintained on a regular basis. The last shutdown of the water supply line at the reservoir occurred 1-1/2 to 2 years ago. All current operations are now performed at the new pumping station downstream of the reservoir.

4.4 Description of Warning System in Effect

None exists for this dam.

4.5 Evaluation

The operation and maintenance appears to be adequate for the dam's present status. Improvements could be made by instituting a routine inspection and maintenance program on an annual or semi-annual basis, as outlined in Section 7.

SECTION 5 - HYDRAULIC/HYDROLOGIC

5.1 Evaluation of Features

a. General

The Meredith Reservoir is a storage reservoir with an earth embankment dam. The drainage area is relatively small and during hot summer months it is necessary to pump water from Lake Waukegan to maintain water in the reservoir.

b. Design Data

There is no existing design data for this dam relative to hydraulic/hydrologic computations.

c. Experience Data

There are no records of high flow conditions at the site.

d. Visual Observations

The visual inspection of the dam indicated that the overflow spillway had not been utilized in the recent past.

e. Test Flood Analysis

The dam is classified to be small with a significant hazard classification. Since the hazard classification is significant, a test flood of one-half the probable maximum flood was selected as a criterion for this study. The calculation was performed using the HEC-1 computer program which produced a routed test flood outflow of 381 CFS. Input data and results are contained in Appendix D of this report.

The test flood of 381 CFS would overtop the dam by 0.2 feet. The spillway capacity of 318 CFS represents 83.5 percent of the HEC-1 test flood.

f. Dam Failure Analysis

A failure of the Meredith Dam would route a significant flood wave into a relatively small stream channel. Assuming a flood wave of two-thirds the height of the dam, a seventeen-foot wave would produce extensive overbank flow and major erosion damage. Approximately 2000 feet downstream, the flood wave would contact Reservoir Road and a single family

residence with extensive erosion to the roadway and the potential for loss of life. A cemetery in this area would also receive erosion damage with possible public health problem .

The flood wave would continue down the natural stream valley for another 1800 feet until reaching a new highway embankment for relocated Route 104. The embankment is approximately 20 to 30 feet high and contains two reinforced concrete culverts. The embankment and culverts would effectively dampen the flood wave and no further damage would result downstream of that point.

SECTION 6 - STRUCTURAL STABILITY

6.1 Evaluation of Structural Stability

a. Visual Observations

The visual inspection did not disclose any findings indicating stability problems.

b. Design and Construction Data

The design and construction data available do not include information concerning the types of soils in the cross-section of the dam, and thus it is not possible to analyze its stability. There is no design data available to indicate whether a stability or seepage analysis was performed.

c. Operating Records

The operating records available do not include any indication of dam instability.

d. Post-Construction Changes

The records do not contain reference to post-construction changes except for gate house and spillway repairs.

e. Seismic Stability

The dam is located in Seismic Zone 2 and in accordance with recommended Phase I guidelines does not warrant seismic analysis.

SECTION 7 - ASSESSMENT, RECOMMENDATIONS/ REMEDIAL MEASURES

7.1 Dam Assessment

a. Condition

The visual inspection and records indicate that the dam is in fair condition. The following areas of concern for possible future problems were determined during the inspection.

1. Trees and brush are growing on the dam embankment.
2. The spillway is showing signs of deterioration.
3. A wet area was found at the base of the dam.

b. Adequacy of Information

There is practically no data available for this dam and this evaluation is based solely on the visual inspection.

c. Urgency

The recommendations given in Section 7.2 should be carried out within one year of the receipt of this report.

d. Need for Additional Investigations

None.

7.2 Recommendations

The dam is judged to be in fair overall condition. It is recommended that the following items be performed under the guidance of a qualified engineer:

1. Repair the spalled and cracked concrete on the spillway walls and floor.
2. Repair the operating valves in the control tower.
3. Perform an inspection of the upstream dam embankment at low water conditions.

7.3 Remedial Measures

a. Operation and Maintenance Procedures

1. Institute a program of annual periodic technical inspections.

2. The trees and bushes growing on the dam should be removed yearly.
3. The existing tree stumps on the downstream slope should be inspected yearly for indications of seepage in their vicinity.
4. The wet area downstream of the dam should be observed periodically to detect any possible seepage flows.
5. The spillway should be subject to maintenance every two years. This would include repairs to the stone training walls, and patching of any cracked and spalled concrete. The first maintenance should be performed within one year.
6. Establish a formal warning system.
7. Maintain all gates in operational condition.

APPENDIX A

VISUAL INSPECTION CHECK LIST

VISUAL INSPECTION CHECK LIST
PARTY ORGANIZATION

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

TIME 11:15-2:15

WEATHER Cool-Clear

W.S. ELEV. U.S. DN.S.

PARTY:

- | | | |
|------------------------------------|------------|-------------------|
| 1. <u>James H. Maynes</u> | <u>D-H</u> | 6. <u> </u> |
| 2. <u>James A. Dohrman</u> | <u>D-H</u> | 7. <u> </u> |
| 3. <u>Vern Clifford</u> | <u>D-H</u> | 8. <u> </u> |
| 4. <u>Gonzalo Castro</u> | <u>GEI</u> | 9. <u> </u> |
| 5. <u>Ken Stern, New Hampshire</u> | | 10. <u> </u> |
| <u>Water Resources Board</u> | | |

PROJECT FEATURE	INSPECTED BY	REMARKS
1. <u> </u>		
2. <u> </u>		
3. <u> </u>		
4. <u> </u>		
5. <u> </u>		
6. <u> </u>		
7. <u> </u>		
8. <u> </u>		
9. <u> </u>		
10. <u> </u>		

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM DATE November 13, 1978
 PROJECT FEATURE _____ NAME _____
 DISCIPLINE _____ NAME _____

AREA EVALUATED	CONDITION
<u>DAM EMBANKMENT</u>	
Crest Elevation	
Current Pool Elevation	
Maximum Impoundment to Date	Not known.
Surface Cracks	None.
Pavement Condition	None.
Movement or Settlement of Crest	Not observable. Traffic ruts.
Lateral Movement	Not observable.
Vertical Alignment	Too irregular to judge.
Horizontal Alignment	Too irregular to judge.
Condition at Abutment and at Concrete Structures	Erosion at discharge end of spillway walls.
Indications of Movement of Structural Items on Slopes	None except for bridge footing.
Trespassing on Slopes	None apparent.
Sloughing or Erosion of Slopes or Abutments	Minimum - downstream.
Rock Slope Protection - Riprap Failures	Good condition.
Unusual Movement or Cracking at or Near Toes	None observed.
Downstream Seepage	Apparent seepage at highest section at downstream toe.
Piping or Boils	None observed.
Foundation Drainage Features	None known.
Toe Drains	None known.
Instrumentation System	None.

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

PROJECT FEATURE _____

NAME _____

DISCIPLINE _____

NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - CONTROL TOWER</u>	
a. Concrete and Structural	
General Condition	Good condition - recent concrete work.
Condition of Joints	Existing are good.
Spalling	None observed.
Visible Reinforcing	None observed.
Rusting or Staining of Concrete	None observed.
Any Seepage or Efflorescence	None observed.
Joint Alignment	Good.
Unusual Seepage or Leaks in Gate Chamber	Fall of water - not drained.
Cracks	None observed.
Rusting or Corrosion of Steel	Moderate.
b. Mechanical and Electrical	
Air Vents	None.
Float Wells	None.
Crain Hoist	None.
Elevator	None.
Hydraulic System	None.
Service Gate Valves	6 - gates may be operable only with undue force. No regular maintenance program.
Emergency Gates	None.
Lightning Portection System	None.
Emergency Power System	None.
Wiring and Lighting System in Gate Chamber	No power at site.

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

PROJECT FEATURE _____

NAME _____

DISCIPLINE _____

NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - TRANSITION</u> <u>AND CONDUIT</u> General Condition of Concrete Rust or Staining on Concrete Spalling Erosion or Cavitation Cracking Alignment of Monoliths Alignment of Joints Numbering of Monoliths	Under Water

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

PROJECT FEATURE _____

NAME _____

DISCIPLINE _____

NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - OUTLET STRUCTURE AND OUTLET CHANNEL</u>	
General Condition of Concrete	
Rust or Staining	
Spalling	
Erosion or Cavitation	
Visible Reinforcing	Break in cover.
Any Seepage or Efflorescence	
Condition at Joints	
Drain Holes	
Channel	Stone masonry culvert.
Loose Rock or Trees Overhanging Channel	
Condition of Discharge Channel	Downstream of road - natural stream.

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

PROJECT FEATURE _____

NAME _____

DISCIPLINE _____

NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - SPILLWAY WEIR, APPROACH AND DISCHARGE CHANNELS</u>	
a. Approach Channel	Reservoir.
General Condition	
Loose Rock Overhanging Channel	
Trees Overhanging Channel	
Floor of Approach Channel	
b. Weir and Training Walls	
General Condition of Concrete	Poor.
Rust or Staining	None.
Spalling	Major.
Any Visible Reinforcing	Some.
Any Seepage or Efflorescence	None.
Drain Holes	None.
c. Discharge Channel	
General Condition	Concrete to bridge; stone under bridge.
Loose Rock Overhanging Channel	Stone masonry wall collapsed.
Trees Overhanging Channel	Small.
Floor of Channel	Riprap.
Other Obstructions	Rock falling in.

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

PROJECT FEATURE _____

NAME _____

DISCIPLINE _____

NAME _____

AREA EVALUATED	CONDITION
<p><u>OUTLET WORKS - INTAKE CHANNEL AND</u> <u>INTAKE STRUCTURE</u></p> <p>a. Approach Channel</p> <p>Slope Conditions</p> <p>Bottom Conditions</p> <p>Rock Slides or Falls</p> <p>Log Boom</p> <p>Debris</p> <p>Condition of Concrete Lining</p> <p>Drains or Weep Holes</p> <p>b. Intake Structure</p> <p>Condition of Concrete</p> <p>Stop Logs and Slots</p>	<p>None.</p>

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

PROJECT FEATURE _____

NAME _____

DISCIPLINE

NAME _____

AREA EVALUATED	CONDITION
<u>OUTLET WORKS - SERVICE BRIDGE</u>	
a. Super Structure	
Bearings	Concrete.
Anchor Bolts	None.
Bridge Seat	None.
Longitudinal Members	Good.
Under Side of Deck	Good.
Secondary Bracing	None.
Deck	Good condition.
Drainage System	Good.
Railings	Good
Expansion Joints	Not applicable.
Paint	Good
b. Abutments and Piers	
General Condition of Concrete	Cracked - 6-inch openings.
Alignment of Abutment	Poor.
Approach to Bridge	Good.
Condition of Seat & Backwall	
	Will be under water during flood conditions.

PERIODIC INSPECTION CHECK LIST

PROJECT MEREDITH RESERVOIR DAM

DATE November 13, 1978

PROJECT FEATURE _____

NAME _____

DISCIPLINE _____

NAME _____

AREA EVALUATED	CONDITION
<u>RESERVOIR</u>	
Stability of Shoreline	Good.
Sedimentation	None observable - minimal.
Changes in Watershed Runoff Potential	Possible development.
Upstream Hazards	None.
Downstream Hazards	Reservoir Road - low downtown.
Alert Facilities	None.
Hydrometeorological Gages	Homemade water level - nonrecording.
Operational & Maintenance Regulations	Nonexistent.
	1. All valves not operated recently.
	2. Headworks not used.
	3. Last shutdown 1-1/2 - 2 years.
	4. Pressure from gate/pump house Lake Waukegan.

APPENDIX B

PROJECT RECORDS AND PLANS

1. Listing of Design, Construction and Maintenance Records:

None.

2. Copies of Past Inspection Reports:

- a. N.H. Water Resources Board, September 9, 1934.
- b. N.H. Water Control Commission, July 10, 1939.
- c. N.H. Water Control Commission, June 20, 1951.
- d. N.H. Water Resources Board, August 15, 1975

3. Plans:

- a. Site Plan
- b. Details-Sections

MASSACHUSETTS HAMPSHIRE WATER RESOURCES BOARD
INVENTORY OF DAMS AND WATER POWER DEVELOPMENTS

D.M.

BASIN Merrimack NO. 4 - 507 - I-3770 0.2
 RIVER Merrimack MILES FROM MOUTH D.A.SQ.MI. 0.5
 TOWN Merrimack OWNER Merrimack Village Fire Dept.
 LOCAL NAME OF DAM _____
 E.ILT _____ DESCRIPTION Earth Embankment - Stone
Earth, Concrete in Earth

POND AREA-ACRES _____ DRAINAGE FT. _____ POND CAPACITY-ACRE FT. _____
 HEIGHT-TOE TO BED OF STREAM-FT. 2.0 MAX. _____ MIN. _____
 OVERALL LENGTH OF DAM-FT. 300 MAX. FLOOD HEIGHT ABOVE CREST-FT. _____
 PERMANENT CREST ELEV. U.S.G.S. _____ LOCAL GAGE _____
 TIDWATER ELEV. U.S.G.S. _____ LOCAL GAGE _____
 SPILLWAY LENGTHS-FT. 14.32 FREEBOARD-FT. 4.0
 FLASHBOARDS-TYPE, HEIGHT ABOVE CREST None
 W. STR. GATES-NO. _____ WIDTH MAX. OPENING _____ DEPTH SILL BELOW CREST _____

REMARKS Condition Fair

3.6 Lot 12 to 14 on 2nd St. 1386 Merrimack St., Merrimack, Mass.

POWER DEVELOPMENT

UNITS	NO.	RATED HP	HEAD FEET	C.F.S. FULL GAGE	KW	MAKE

USE Domestic

REMARKS Fire Pump

DATE 9/10/64

NEW HAMPSHIRE WATER CONTROL COMMISSION
DATA ON DAMS IN NEW HAMPSHIRE

LOCATION

STATE NO. 155.04
Town Meredith ✓ : County Bellnap
Stream Reservoir ✓
Basin-Primary Merrimack ✓ : Secondary Winnepesaukee ✓
Local Name _____
Coordinates—Lat. 43° 40' - 12800 : Long. 71° 50' + 1250

GENERAL DATA

Drainage area: Controlled _____ Sq. Mi.: Uncontrolled _____ Sq. Mi.: Total 0.54 ✓ Sq. Mi.
Overall length of dam 400 ft.: Date of Construction _____
Height: Stream bed to highest elev. 16 ft.: Max. Structure 21 ft.
Cost—Dam _____ : Reservoir _____

DESCRIPTION

Earth embankment stone Earth concrete on earth ✓

Waste Gates

Type _____
Number _____ : Size _____ ft. high x _____ ft. wide
Elevation Invert _____ : Total Area _____ sq. ft.
Hoist _____

Waste Gates Conduit

Number _____ : Materials _____
Size _____ ft.: Length _____ ft.: Area _____ sq. ft.

Embankment

Type _____
Height—Max. _____ ft.: Min. _____ ft.
Top—Width _____ : Elev. _____ ft.
Slopes—Upstream _____ on _____ : Downstream _____ on _____
Length—Right of Spillway _____ : Left of Spillway _____

Spillway

Materials of Construction _____
Length—Total 10.4 ✓ ft.: Net _____ ft.
Height of permanent section—Max. 21 ft.: Min. _____ ft.
Flashboards—Type Plastic : Height _____ ft.
Elevation—Permanent Crest _____ : Top of Flashboard _____
Flood Capacity 325 cfs.: _____ cfs/sq. mi.

Abutments

Materials: _____
Freeboard: Max. 41 ✓ ft.: Min. _____ ft.

Headworks to Power Devel.—(See "Data on Power Development")

OWNER

Meredith Village Fire District

REMARKS

Condition fair fire pond - Water supply
about 1 acre about 3 cfs at spillway

C.D.C

7/10/70

NEW HAMPSHIRE WATER CONTROL COMMISSION

REPORT ON DAM INSPECTION

TOWN Meredith DAM NO. 155 STREAM Deer River Brook

OWNER Town of Meredith ADDRESS 1000 1st St., N.H.

In accordance with Section 20 of Chapter 133, Laws of 1937, the above dam was inspected by me on 4/15/57 accompanied by

NOTES ON PHYSICAL CONDITION

Abutments Excellent

Spillway Good

Gates Excellent

Other

CHANGES SINCE LAST INSPECTION

FUTURE INSPECTIONS 1/5

This dam (is) (~~is not~~) a menace because it is not

REMARKS Water capacity increased

Water level 1.5 ft above spillway crest

Copy to Owner	Date

Robert W. Moore
INSPECTOR

NEW HAMPSHIRE WATER CONTROL COMMISSION

WATER RESOURCES BOARD

SITE EVALUATION DATA

OWNER: Town of Meredith (water works) TELEPHONE NO. _____

MAILING ADDRESS: _____

SITE LOCATION (TOWN OR CITY) MeredithNAME OF STREAM OR WATERBODY: ReservoirQUADRANGLE: Holderness LOCATION IT 0.35 Dn 9.27HEIGHT OF (PROPOSED, EXISTING) DAM 25 LENGTH 100TYPE OF (PROPOSED, EXISTING) STRUCTURE Earth embankment
spillway with concrete & stone abutmentsDRAINAGE AREA 0.54 SM POND AREA 3 AAVAILABLE ARTIFICIAL STORAGE: PERMANENT: _____ TEMPORARY: _____ TOTAL 15

EXISTING DEVELOPMENT DOWNSTREAM OF (PROPOSED, EXISTING) STRUCTURE _____

None 1/2 mi down stream

POTENTIAL DEVELOPMENT DOWNSTREAM OF (PROPOSED, EXISTING) STRUCTURE _____

Possible home developmentPOTENTIAL DAMAGE DOWNSTREAM OF STRUCTURE (EXPLAIN IN DETAIL AND INCLUDE ANY POTENTIAL LOSS OF LIFE ESTIMATE) damage to Road and someOTHER COMMENTS: Town Water SupplyCLASS OF STRUCTURE -- ~~REPAIR~~ MAINTENANCE A 5 G DAM # 155.04DATE OF INSPECTION: 15 Aug 75

SIGNED _____

SIGNATURE

N. H. WATER RESOURCES BOARD
Concord, N. H. 03301

DAM SAFETY INSPECTION REPORT FORM

Town: Merritt Dam Number: 135.04

Inspected by: J. Burnett Date: 15 Aug 1985

Local name of dam or water body: Reservoir

Owner: Town Address: _____

Owner was/was not interviewed during inspection.

Drainage Area: 5.4 sq. mi. Stream: 11/2 N. Main

Pond Area: 3 Acre, Storage 15 Ac-Ft. Max. Head 25 Ft.

Foundation: Type Earth, Seepage present at toe - Yes ☐ No ☒

Spillway: Type Overflow, Freeboard over perm. crest: 4 ft

Width 14.3, Flashboard height 0

Max. Capacity 325 c.f.s.

Embankment: Type Earth, Cover Grass Width 15

Upstream slope 1 1/2 to 1; Downstream slope 1 1/2 to 1

Abutments: Type Concrete & Stone, Condition: Good, Fair Poor

Gates or Pond Drain: Size _____ Capacity _____ Type _____

Lifting apparatus _____ Operational condition _____

Changes since construction or last inspection: _____


Downstream development: _____

This dam would ~~would not~~ be a menace if it failed.


Suggested reinspection date: _____

Remarks: Concrete in spillway needs Repair

Small Trees on embankment

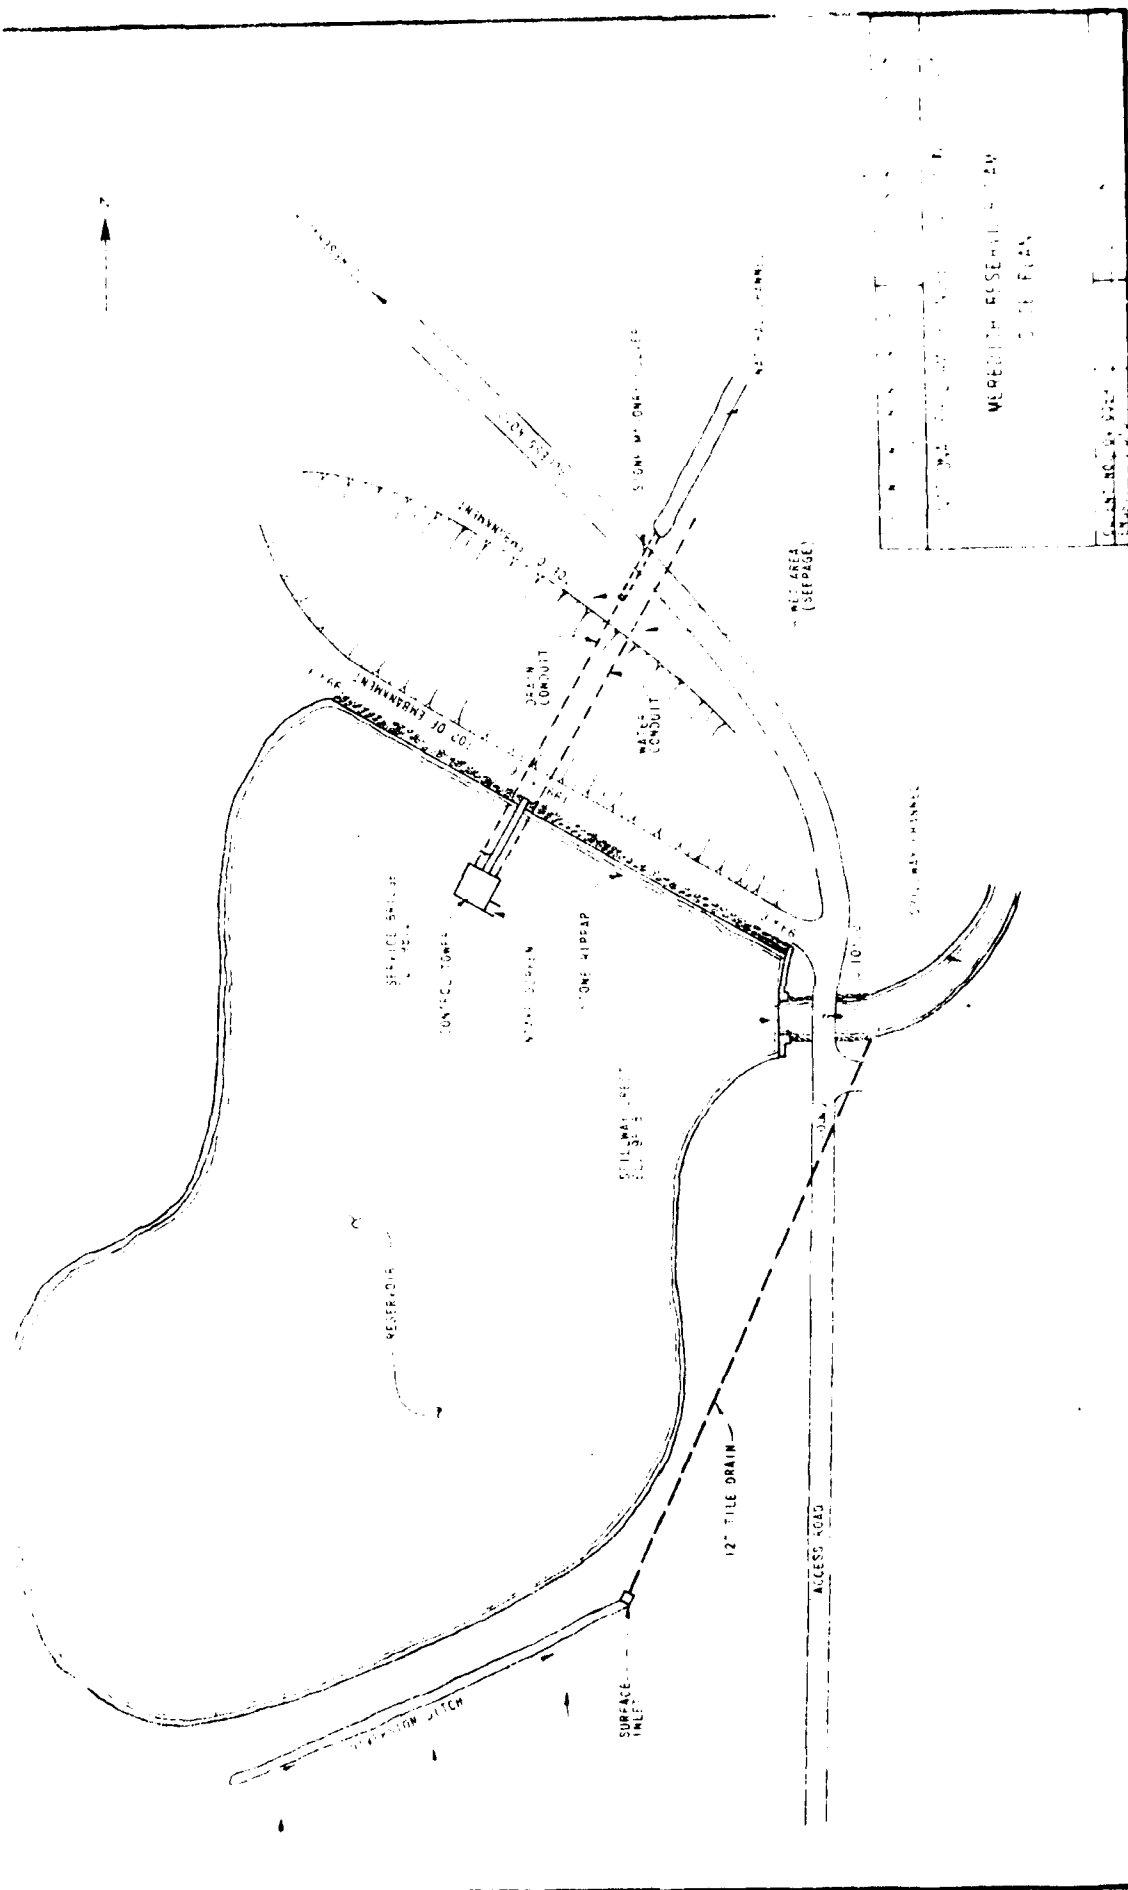

WATER RESERVOIR
SITE PLAN

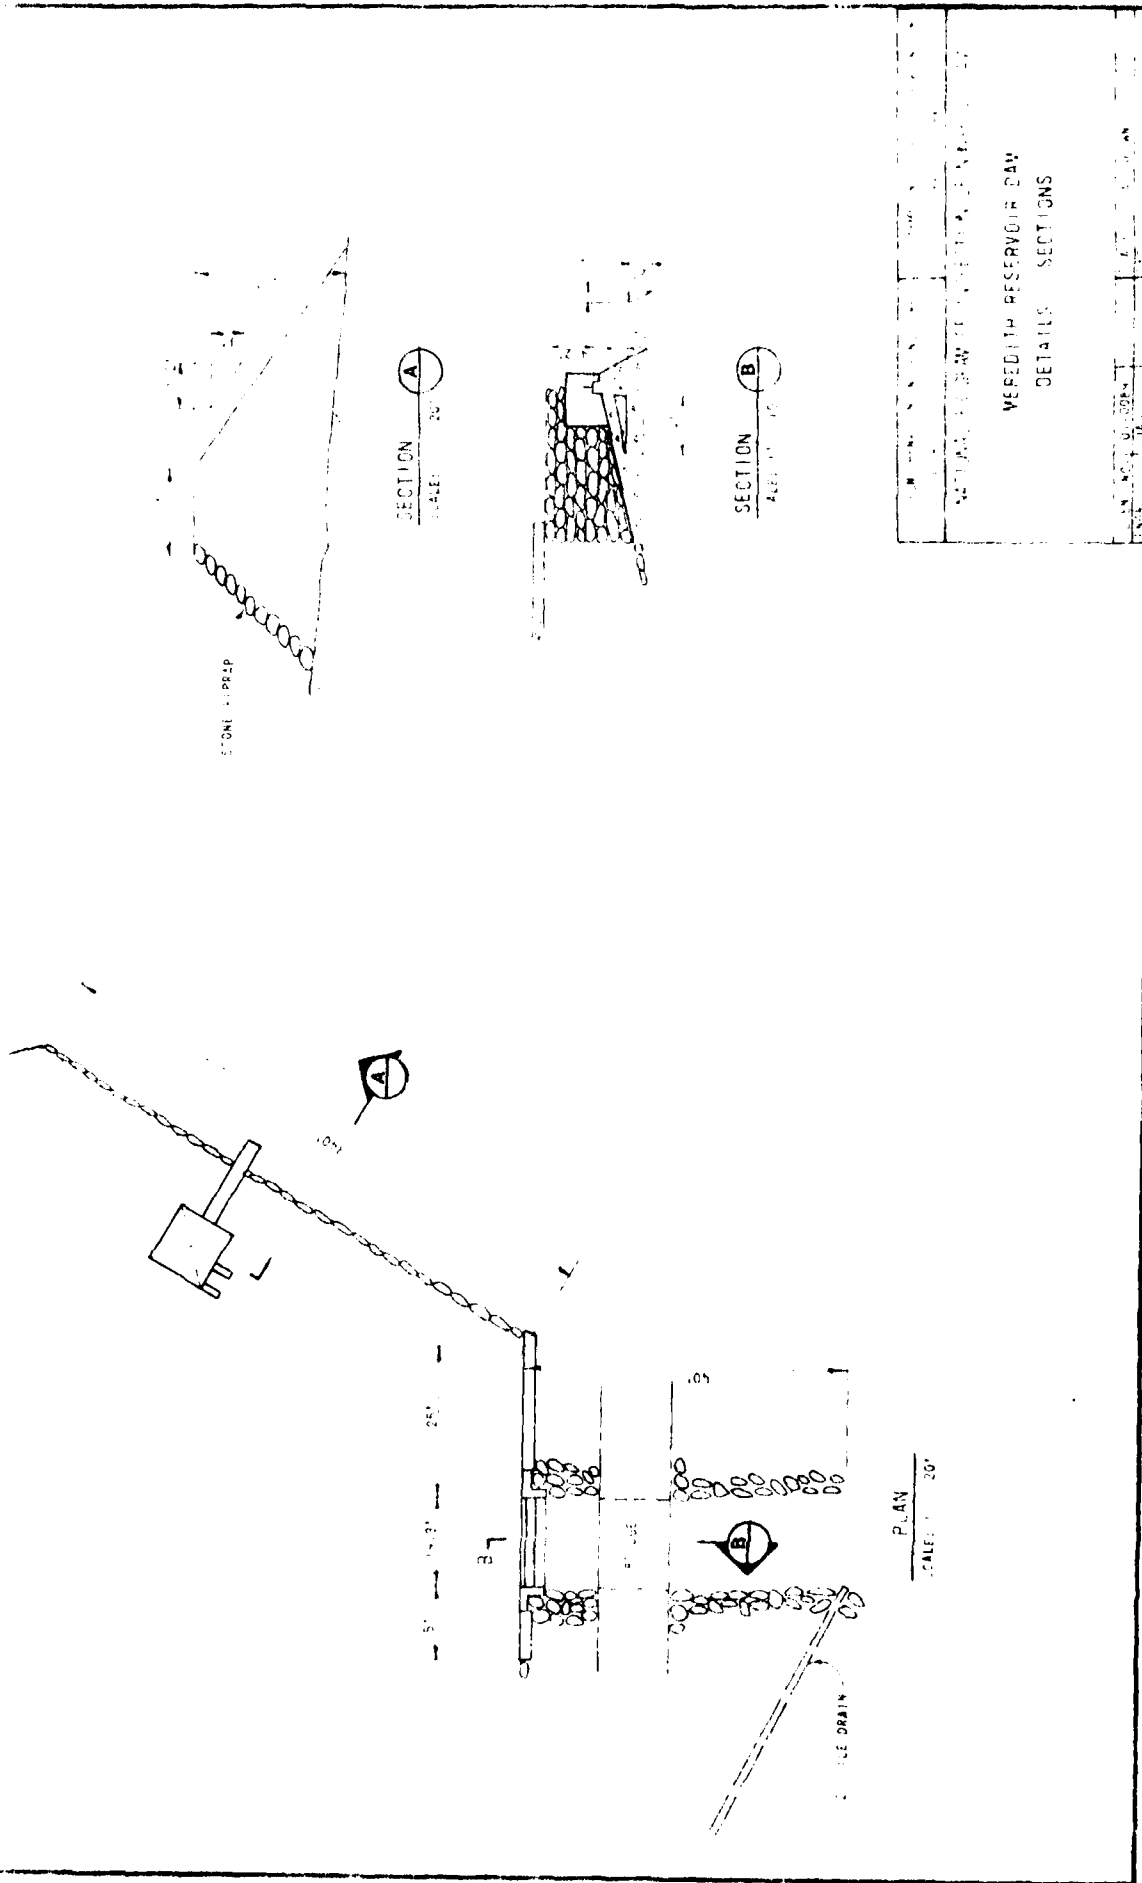

WEIR DAM
DETAILS
SECTIONS

APPENDIX C

PHOTOGRAPHS



#1. VIEW OF EARTH DAM AND CONTROL TOWER



#2. VIEW OF UP-
STREAM DAM
EMBANKMENT



#5. VIEW OF DOWNSTREAM SPILLWAY CHANNEL



#6. VIEW OF LEFT
SPILLWAY TRAINING
WALL AND TREES ON
EMBANKMENT



#9. VIEW OF CONTROL
TOWER BRIDGE
ABUTMENT



#10. VIEW OF DOWNSTREAM SPILLWAY CHANNEL

APPENDIX D

HYDROLOGIC AND HYDRAULIC COMPUTATIONS

DUFRESNE-HENRY ENGINEERING CORPORATION

BY W.H. LEONARD
DATE 1/17/79

SUBJECT MOONSHINE
DOUGLAS AREA
CLASSIFICATION

SHEET NO. 1 OF 2
JOB NO. 28-224

SCALE 1:62500

PERIMETER READING:

DOUBLE ENDING 0.85

$$(.175)(.986) = \underline{\underline{.17 \text{ SQ MILES}}}$$

AREA OF DOUGLAS AREA

Area Height 31'
500000 1000000

Area Calculation SMALL

Area Calculation

Area Calculation SMALL

DUFRESNE-HENRY ENGINEERING CORPORATION

BY W. L. LORING
DATE 2-2-79

SUBJECT TEST PLAN SELECTION & CRITERIA

SHEET NO. 2 OF 2
JOB NO. 2-1-1-1-1

DESIGNER'S VALUE = 1700 SPECIFIED
SPEEDING LIMIT 85.0

CRV = 0.4% L = 14.1
C VALUES TAKEN FROM
TABLE OF HYPERBOLIC
TANGENT

h = 0

$$Q = 0$$

$$h = 1 \quad Q = 0.21 (14.1)(1)^{3/4} = \underline{\underline{45.0 \text{ ft}}}$$

$$h = 1.5 \quad Q = 0.21 (14.1)(1.5)^{3/4} = \underline{\underline{61.0 \text{ ft}}}$$

$$h = 2 \quad Q = 0.21 (14.1)(2)^{3/4} = \underline{\underline{78.0 \text{ ft}}}$$

$$h = 2.5 \quad Q = 0.21 (14.1)(2.5)^{3/4} = \underline{\underline{95.0 \text{ ft}}}$$

$$h = 3 \quad Q = 0.21 (14.1)(3)^{3/4} = \underline{\underline{112.0 \text{ ft}}}$$

$$h = 3.5 \quad Q = 0.21 (14.1)(3.5)^{3/4} = \underline{\underline{128.0 \text{ ft}}}$$

TOP OF D.M. (L.S.
POINT)

$$h = 4 \quad Q = 0.21 (14.1)(4)^{3/4} = \underline{\underline{145.0 \text{ ft}}}$$

$$h = 4.5 \quad Q = 0.21 (14.1)(4.5)^{3/4} = \underline{\underline{162.0 \text{ ft}}}$$

DESIGNER'S VALUE

1700

DESIGNER'S VALUE = 1700 SPECIFIED
SPEEDING LIMIT 85.0

h = 0	0	0
h = 1	45.0	15
h = 1.5	61.0	17
h = 2	78.0	19
h = 2.5	95.0	21
h = 3	112.0	23
h = 3.5	128.0	25
h = 4	145.0	27
h = 4.5	162.0	29
h = 5	180.0	31

STAGE VS. DISCHARGE

DATE: 10/10/50

TOP OF DATA

STAGE (IN FEET)


400

300


200

100

DISCHARGE (C.F.S.)

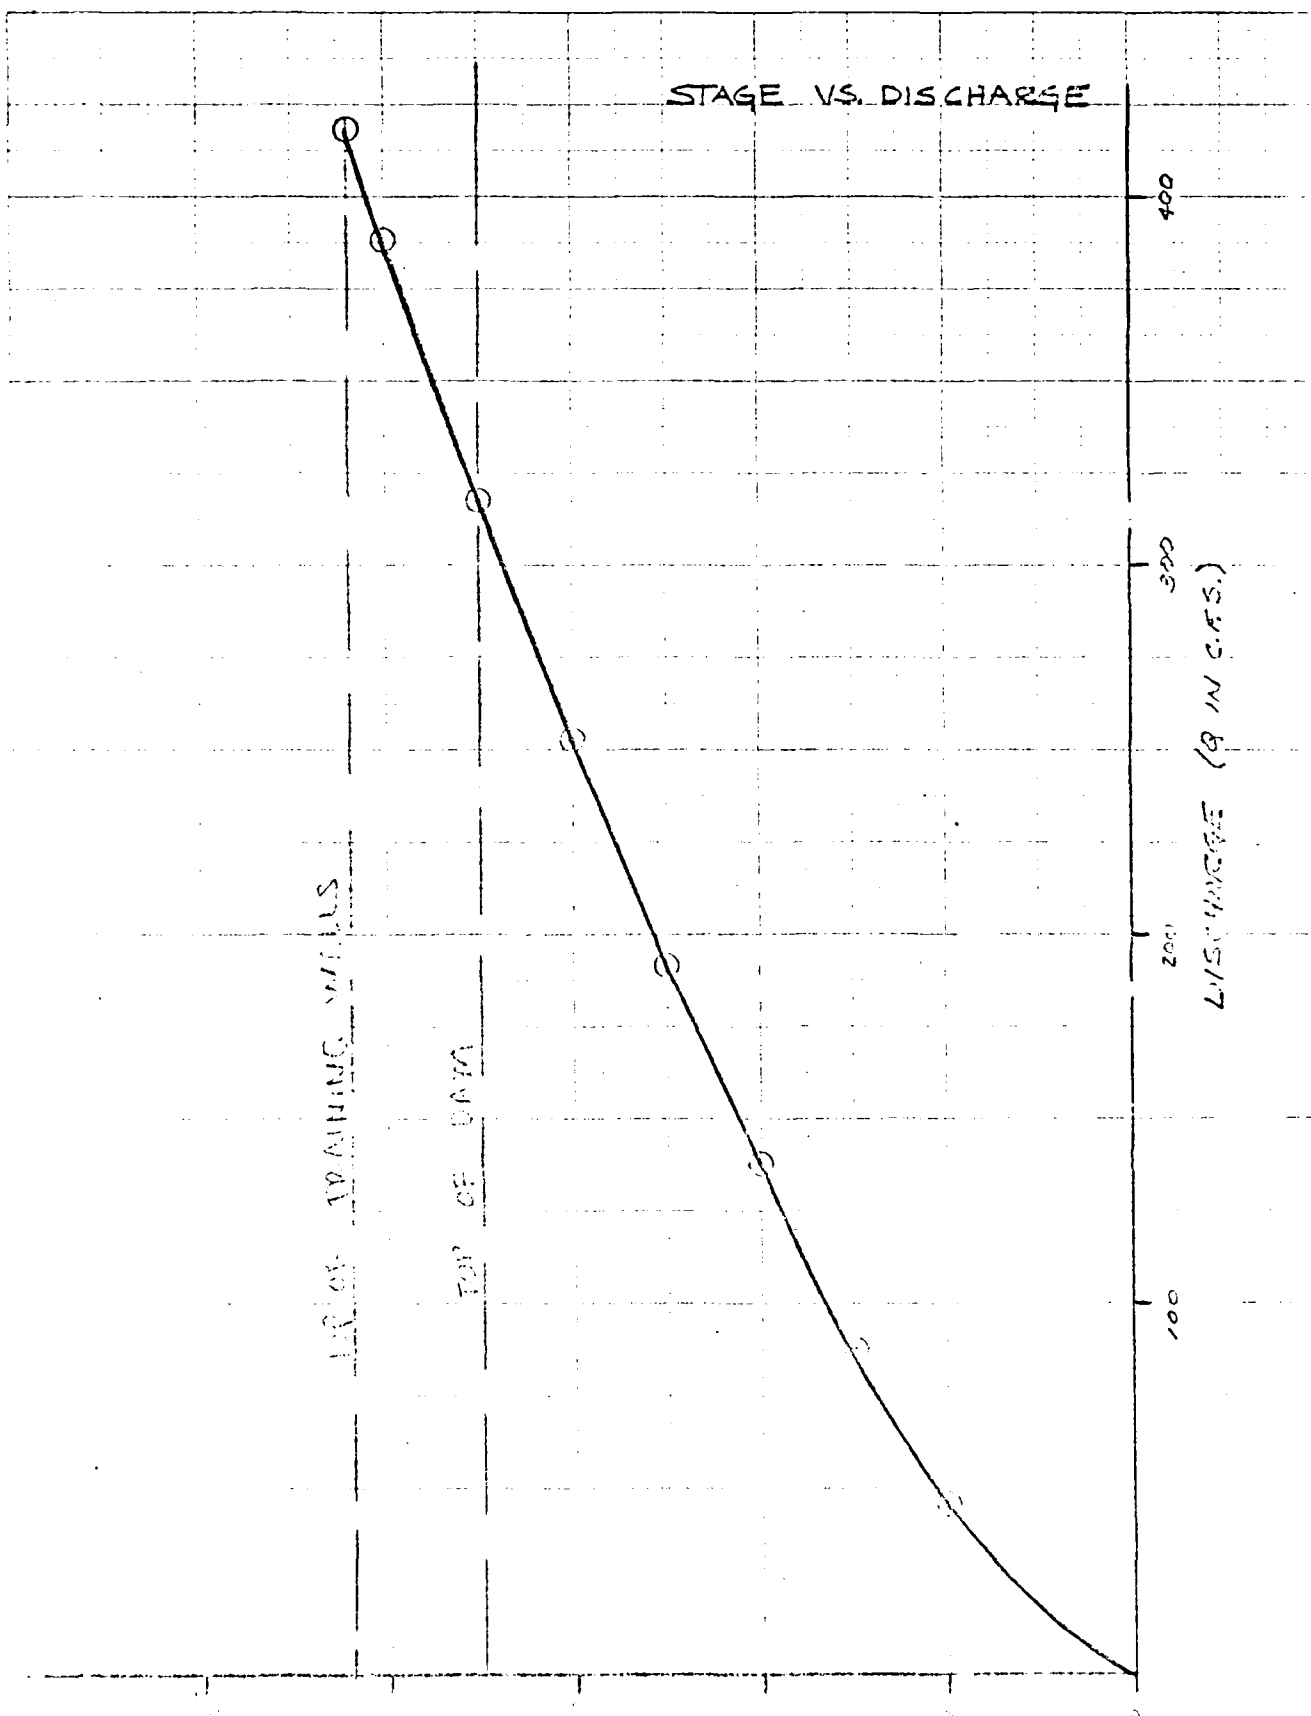

STAGE VS. STORAGE

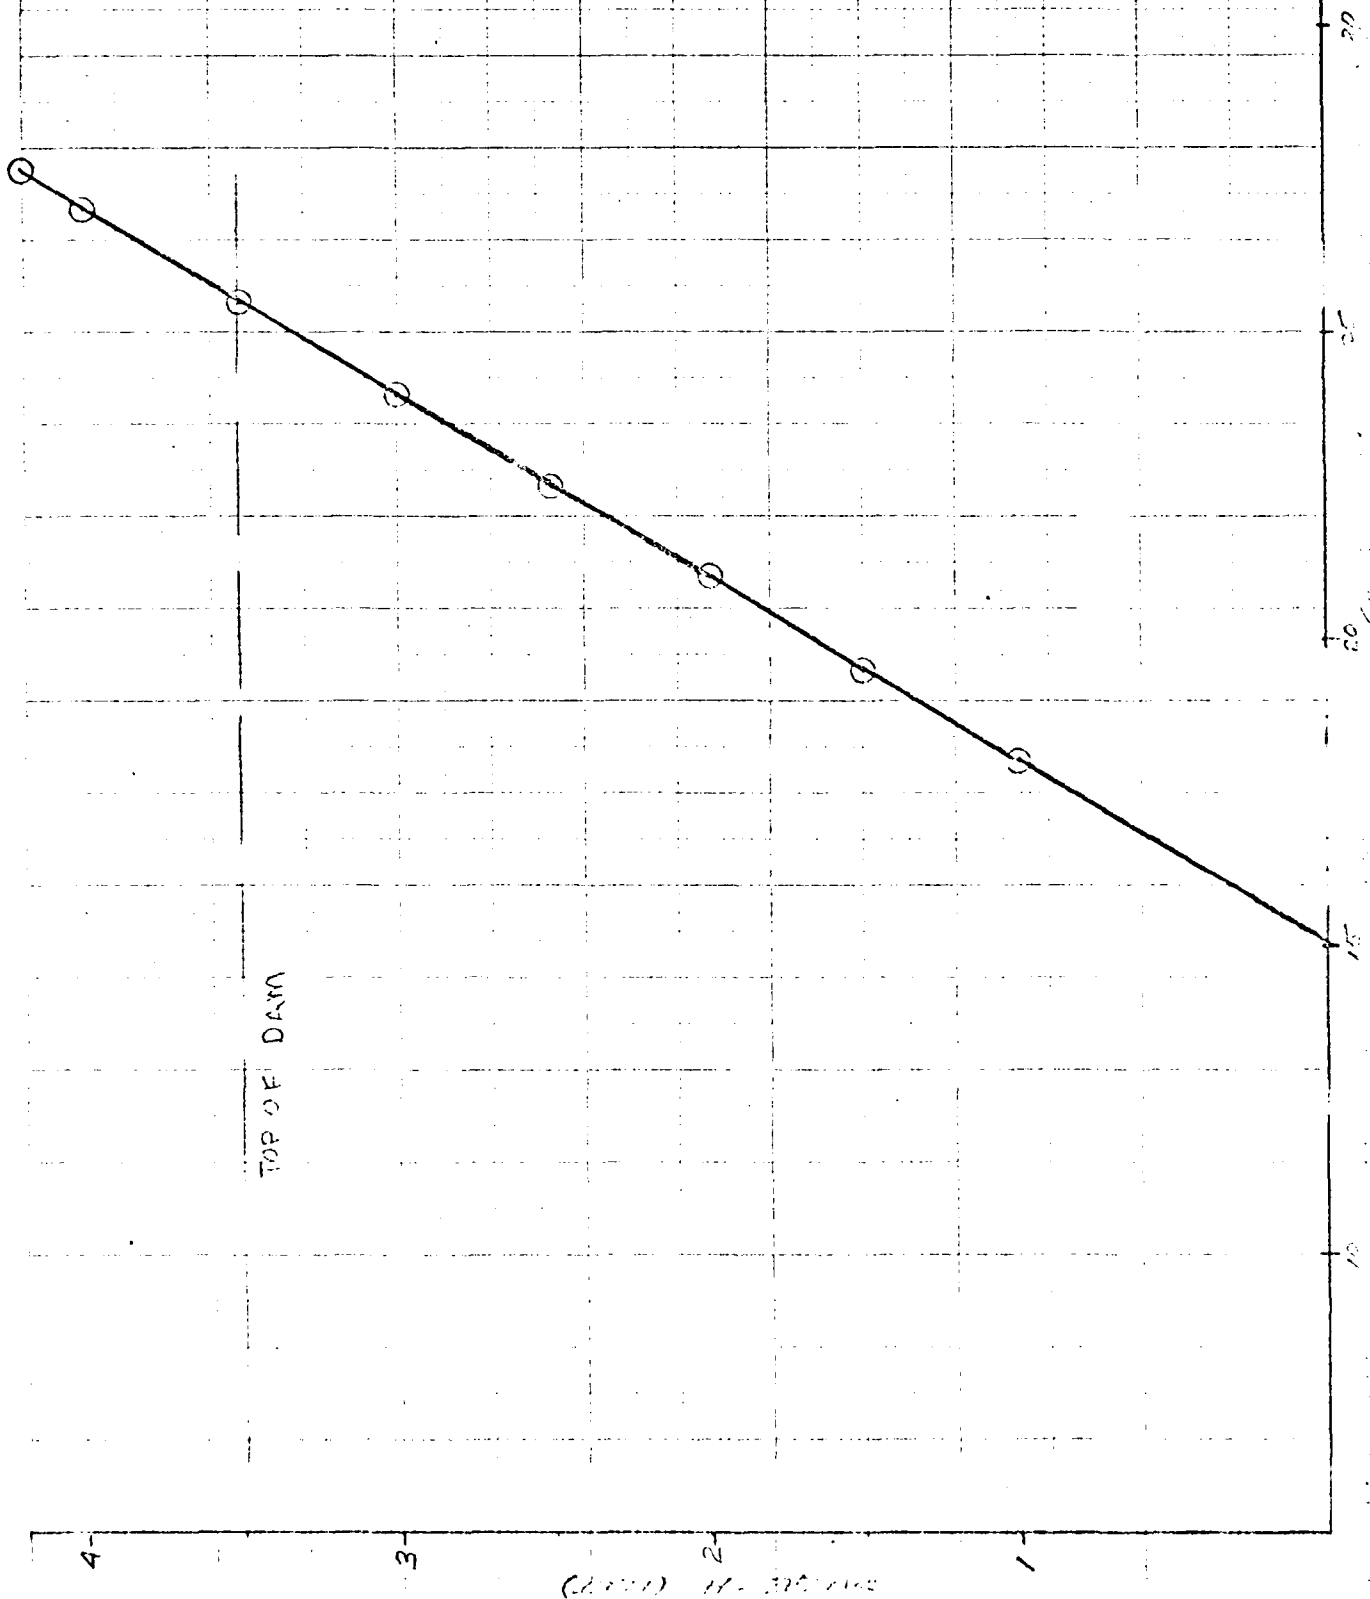

DUFRESNE-HENRY ENGINEERING CORPORATION

BY W.A. LEONARD

SUBJECT MEDICINE RESERVOIR

SHEET NO. 5 OF 8

DATE 3-5-79

SOIL CLASSIFICATION

JOB NO. 04-0089

PREDOMINANT SOILS FOR THE MEDICINE RESERVOIR
DRAINAGE AREA (TAKEN FROM THE SOIL CONSERVATION
SERVICE) ARE

PAID	PAYROLL	30% - C
8th	KIDDERMAN	15% - C
100	GLOUCESTER	55% - B

LAND USE -- WOODLAND
SLOPES -- GRASS

DRAINAGE SURVEY NO. 64 FROM 1955.

THE AVERAGE OF THE USING IT WITH DRAINAGE, DRAINAGE
DRAINAGE AREA 44 ACRES

UNIFORM DRAINAGE LOSS = 2.25/AC

DUFRESNE-HENRY ENGINEERING CORPORATION

BY W. F. LEONARD
DATE 3-5-79

SUBJECT MONTANA RESOURCES
COMPUTED. 2.27

SHEET NO. 6 OF 8
JOB NO. 04-0159

AVERAGE SLOPE

ELEV 10% 780
ELEV 2 35% 840

$$\frac{840 - 780 (5,280)}{1302} = \underline{\underline{324.12' / MILE}}$$

$$\frac{1}{T_p} = 2.2 \left(\frac{4.4}{15} \right)^{.37} \Rightarrow 2.2 \left(\frac{1724.1 (1724.1)}{1324.4} \right)^{.37} = \underline{\underline{.27}}$$

100 YD² FLARE

100 YD² FLARE LENGTH = 6.0 INCHES

FLARE AREA = (.17) (6.0) = 100.5 ACRES

12061 ES-1021
S.C.S.

120 0.1

DUFRESNE-HENRY ENGINEERING CORPORATION

BY W.A. LEONARD
DATE 3-5-79

SUBJECT HERBERT DAM
DAM FAILURE ANALYSIS

SHEET NO. 7 OF 8
JOB NO. 04-1850

IF DAM WERE TO FAIL

$$h \approx 3' \therefore WSEL = 95.8$$

$$y_0 = 24'$$

$$Q = 8/27 W_b \sqrt{g} y_0^{3/2}$$

$$Q = 8/27 (.4)(340) \sqrt{32.2} (24)^{3/2} = \underline{\underline{26,885 \text{ cfs}}}$$

UNDER 100% FLOOD CONDITIONS (1200fs)

$$WSEL = 100 + 205.00 - 100.00 = 205.00' \quad h = 1.8$$

$$\therefore WSEL = 1.8 + 95.8 = 97.6$$

$$Q = 8/27 W_b \sqrt{g} y_0^{3/2}$$

$$y_0 = 23'$$

$$Q = 8/27 (.4)(340) \sqrt{32.2} (23)^{3/2} = \underline{\underline{25,322 \text{ cfs}}}$$

UNDER 100% FLOOD, DAM CONDITIONS

$$WSEL = 100 + 205.00 - 100.00 = 205.00' \quad h = 0$$

$$y_0 = 21'$$

$$Q = 8/27 W_b \sqrt{g} y_0^{3/2}$$

$$Q = 8/27 (.4)(340) \sqrt{32.2} (21)^{3/2} = \underline{\underline{23,655 \text{ cfs}}}$$

DUFRESNE-HENRY ENGINEERING CORPORATION

BY W.A. LEONARD
DATE 2-9-79

SUBJECT 1/4" PNEUMATIC TEST
DAM ENGINE ANALYSIS
USING COMPUTER 1/2 PNE

SHEET NO. 5 OF 5
JOB NO. 04-0000

FROM HEK-1 COMPUTER OUTPUT

$$\underline{1/2 PNE = 331 cfs}$$

FROM STAGE DISCHARGE CURVE $h \approx 4.0'$

$$WSEL = 25.8 + 4 = 29.8$$

WATER WOULD OVERFLOW BY ≈ 2 FEET

IF DAM WERE TO FAIL UNDER THESE CONDITIONS

$$Q = 3.4 WSEL^{3/2} \sqrt{1/2} \quad Q_u = 25.2'$$

$$Q = 3.4 (14.3)(25.2)^{3/2} = \underline{318.5 cfs}$$

Summary Computations

MAY $h = 1.2'$ @ TOP OF TRAINING WALLS

$$Q = 3.4 (14.3)(1.2)^{3/2} = \underline{21.5 cfs}$$

$h = 3.5$ AT TOP OF DAM (LOW POINT)

$$Q = 3.4 (14.3)(3.5)^{3/2} = \underline{318.5 cfs}$$

MEMPHIS RESERVOIR
MEMPHIS, NEW HAMPSHIRE
RESERVOIR STORAGE-OUTFLOW

NO. 144 NHR 0 AMY 10 JHR SPECIFICATION
1 0 0 0 0 0 0 0 0 0
JUPR 3 NHT 0

SUB-AREA RUNOFF COMPUTATION

WATERSHED RUNOFF
ISTAD 1 ICOMP 0 IECN 0 ITAPE 0 JPLI 0 JPRT 0 INAME 1

HYDROGRAPH DATA
IMYD 1 IAD 1 TAREA 0.17 SNAP 0.0 TSDA 0.0 TSPL 1.00 NATU 0.500 ISMUN 0 ISAME 0 LUGAL 0

PRECIP DATA
SPPE 0.0 PMS 18.00 R6 0.0 R12 0.0 R24 0.0 R48 0.0 R72 0.0 R96 0.0

UNIT DATA
STARR 0.0 JULY 0.0 RTIOL 1.00 ERAIN 0.0 STRKS 0.0 RTIOL 1.00 STRIL 0.47 CNSTL 0.20 ALSMA 0.0 RTIMP 0.0

UNIT HYDROGRAPH DATA
TPR 0.27 CPO.75 NTAB 0

REGRESSION DATA
STPR 0.00 QRSR 0.13 RTIOL 1.50

PROPORTIONATE CLARK COEFFICIENTS FROM GIVEN SNYDER CP AND IP ARE 2.19 AND 0.76 INTERVALS

UNIT HYDROGRAPH 5 END-OF-PERIOD COORDINATES, LAUR 0.27 HOURS, CPO 0.75 VOL 1.00
11% 27% 20% 5% 11%

END-OF-PERIOD FLOW

TIME	RAIN	EXCS	CUMP Q
1 0 10	0.02	0.00	5.
1 0 20	0.02	0.00	5.
1 0 30	0.02	0.00	4.
1 0 40	0.02	0.00	4.
1 0 50	0.02	0.00	4.
1 0 60	0.02	0.00	4.
1 1 10	0.02	0.00	4.
1 1 20	0.02	0.00	4.
1 1 30	0.02	0.00	3.
1 1 40	0.02	0.00	3.
1 1 50	0.02	0.00	3.
1 1 60	0.02	0.00	3.
1 2 10	0.02	0.00	3.
1 2 20	0.02	0.00	3.
1 2 30	0.02	0.00	3.
1 2 40	0.02	0.00	3.
1 2 50	0.02	0.00	3.
1 2 60	0.02	0.00	2.
1 3 10	0.02	0.00	2.
1 3 20	0.02	0.00	2.
1 3 30	0.02	0.00	2.
1 3 40	0.02	0.00	2.
1 3 50	0.02	0.00	2.
1 3 60	0.02	0.00	1.
1 4 10	0.02	0.00	1.
1 4 20	0.02	0.00	1.
1 4 30	0.02	0.00	1.
1 4 40	0.02	0.00	1.
1 4 50	0.02	0.00	1.
1 4 60	0.02	0.00	1.
1 5 10	0.02	0.00	1.
1 5 20	0.02	0.00	1.
1 5 30	0.02	0.00	1.
1 5 40	0.02	0.00	1.
1 5 50	0.02	0.00	1.
1 5 60	0.02	0.00	1.
1 6 10	0.05	0.02	14.
1 6 20	0.05	0.02	15.
1 6 30	0.05	0.02	15.
1 6 40	0.05	0.02	15.
1 6 50	0.05	0.02	15.
1 6 60	0.05	0.02	15.
1 7 10	0.05	0.02	15.
1 7 20	0.05	0.02	15.
1 7 30	0.05	0.02	15.
1 7 40	0.05	0.02	15.
1 7 50	0.05	0.02	15.
1 7 60	0.05	0.02	15.
1 8 10	0.05	0.02	15.
1 8 20	0.05	0.02	15.
1 8 30	0.05	0.02	15.
1 8 40	0.05	0.02	15.
1 8 50	0.05	0.02	15.
1 8 60	0.05	0.02	15.
1 9 10	0.05	0.02	15.
1 9 20	0.05	0.02	15.
1 9 30	0.05	0.02	15.
1 9 40	0.05	0.02	15.
1 9 50	0.05	0.02	15.
1 9 60	0.05	0.02	15.
1 10 10	0.05	0.02	15.
1 10 20	0.05	0.02	15.
1 10 30	0.05	0.02	15.
1 10 40	0.05	0.02	15.
1 10 50	0.05	0.02	15.
1 10 60	0.05	0.02	15.
1 11 10	0.05	0.02	15.
1 11 20	0.05	0.02	15.
1 11 30	0.05	0.02	15.
1 11 40	0.05	0.02	15.
1 11 50	0.05	0.02	15.
1 11 60	0.05	0.02	15.
1 12 10	0.05	0.02	15.
1 12 20	0.05	0.02	15.
1 12 30	0.05	0.02	15.
1 12 40	0.05	0.02	15.
1 12 50	0.05	0.02	15.
1 12 60	0.05	0.02	15.
1 13 10	0.05	0.02	15.
1 13 20	0.05	0.02	15.
1 13 30	0.05	0.02	15.
1 13 40	0.05	0.02	15.
1 13 50	0.05	0.02	15.
1 13 60	0.05	0.02	15.

1 15 00	1.27	1.23	807.
1 16 10	0.47	0.43	716.
1 16 20	0.47	0.43	497.
1 16 30	0.47	0.43	334.
1 16 40	0.47	0.43	242.
1 16 50	0.47	0.43	284.
1 16 60	0.47	0.43	284.
1 17 10	0.37	0.33	272.
1 17 20	0.37	0.33	249.
1 17 30	0.37	0.33	274.
1 17 40	0.37	0.33	219.
1 17 50	0.37	0.33	218.
1 17 60	0.37	0.33	218.
1 18 10	0.03	0.00	180.
1 18 20	0.03	0.00	89.
1 18 30	0.03	0.00	78.
1 18 40	0.03	0.00	75.
1 18 50	0.03	0.00	72.
1 18 60	0.03	0.00	69.
1 19 10	0.03	0.00	66.
1 19 20	0.03	0.00	64.
1 19 30	0.03	0.00	61.
1 19 40	0.03	0.00	59.
1 19 50	0.03	0.00	56.
1 19 60	0.03	0.00	54.
1 20 10	0.03	0.00	52.
1 20 20	0.03	0.00	50.
1 20 30	0.03	0.00	48.
1 20 40	0.03	0.00	46.
1 20 50	0.03	0.00	44.
1 20 60	0.03	0.00	42.
1 21 10	0.03	0.00	41.
1 21 20	0.03	0.00	39.
1 21 30	0.03	0.00	38.
1 21 40	0.03	0.00	36.
1 21 50	0.03	0.00	35.
1 21 60	0.03	0.00	33.
1 22 10	0.03	0.00	32.
1 22 20	0.03	0.00	31.
1 22 30	0.03	0.00	29.
1 22 40	0.03	0.00	28.
1 22 50	0.03	0.00	27.
1 22 60	0.03	0.00	26.
1 23 10	0.03	0.00	25.
1 23 20	0.03	0.00	24.
1 23 30	0.03	0.00	23.
1 23 40	0.03	0.00	22.
1 23 50	0.03	0.00	21.
1 23 60	0.03	0.00	20.

SUM 23.64 19.50 14377.

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
CFS	807.	338.	100.	100.	14375.
INCHES		18.49	21.85	21.85	21.85
AC-FT		168.	198.	198.	198.


23 60. 1	:	:	:	:	:	:	:	:	:
23 59. 1	:	:	:	:	:	:	:	:	:
23 58. 1	:	:	:	:	:	:	:	:	:
23 57. 1	:	:	:	:	:	:	:	:	:
23 56. 1	:	:	:	:	:	:	:	:	:
23 55. 1	:	:	:	:	:	:	:	:	:
23 54. 1	:	:	:	:	:	:	:	:	:
23 53. 1	:	:	:	:	:	:	:	:	:
23 52. 1	:	:	:	:	:	:	:	:	:
23 51. 1	:	:	:	:	:	:	:	:	:
23 50. 1	:	:	:	:	:	:	:	:	:


RUNOFF MULTIPLIED BY 0.50

2.	2.	2.	2.	2.	2.	2.	2.	2.	2.
2.	2.	1.	1.	1.	1.	1.	1.	1.	1.
1.	1.	1.	1.	1.	1.	1.	1.	1.	1.
1.	1.	1.	1.	1.	1.	1.	2.	7.	7.
8.	8.	8.	8.	8.	8.	7.	7.	7.	7.
7.	7.	7.	7.	7.	7.	7.	7.	7.	7.
7.	7.	7.	7.	7.	7.	7.	7.	7.	7.
7.	7.	23.	51.	90.	97.	98.	93.	102.	111.
113.	120.	120.	120.	126.	139.	150.	152.	153.	153.
136.	131.	380.	400.	404.	404.	358.	248.	167.	166.
142.	142.	136.	122.	112.	110.	109.	109.	90.	46.
39.	37.	36.	34.	33.	32.	31.	29.	28.	27.
26.	25.	24.	23.	22.	21.	20.	20.	19.	18.
17.	17.	16.	15.	15.	14.	14.	13.	13.	12.
12.	11.	11.	10.						

CFS	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
INCHES	404.	169.	50.	50.	7187.
AC-FT		9.25	10.92	10.92	10.92
		84.	99.	99.	99.

[illegible]

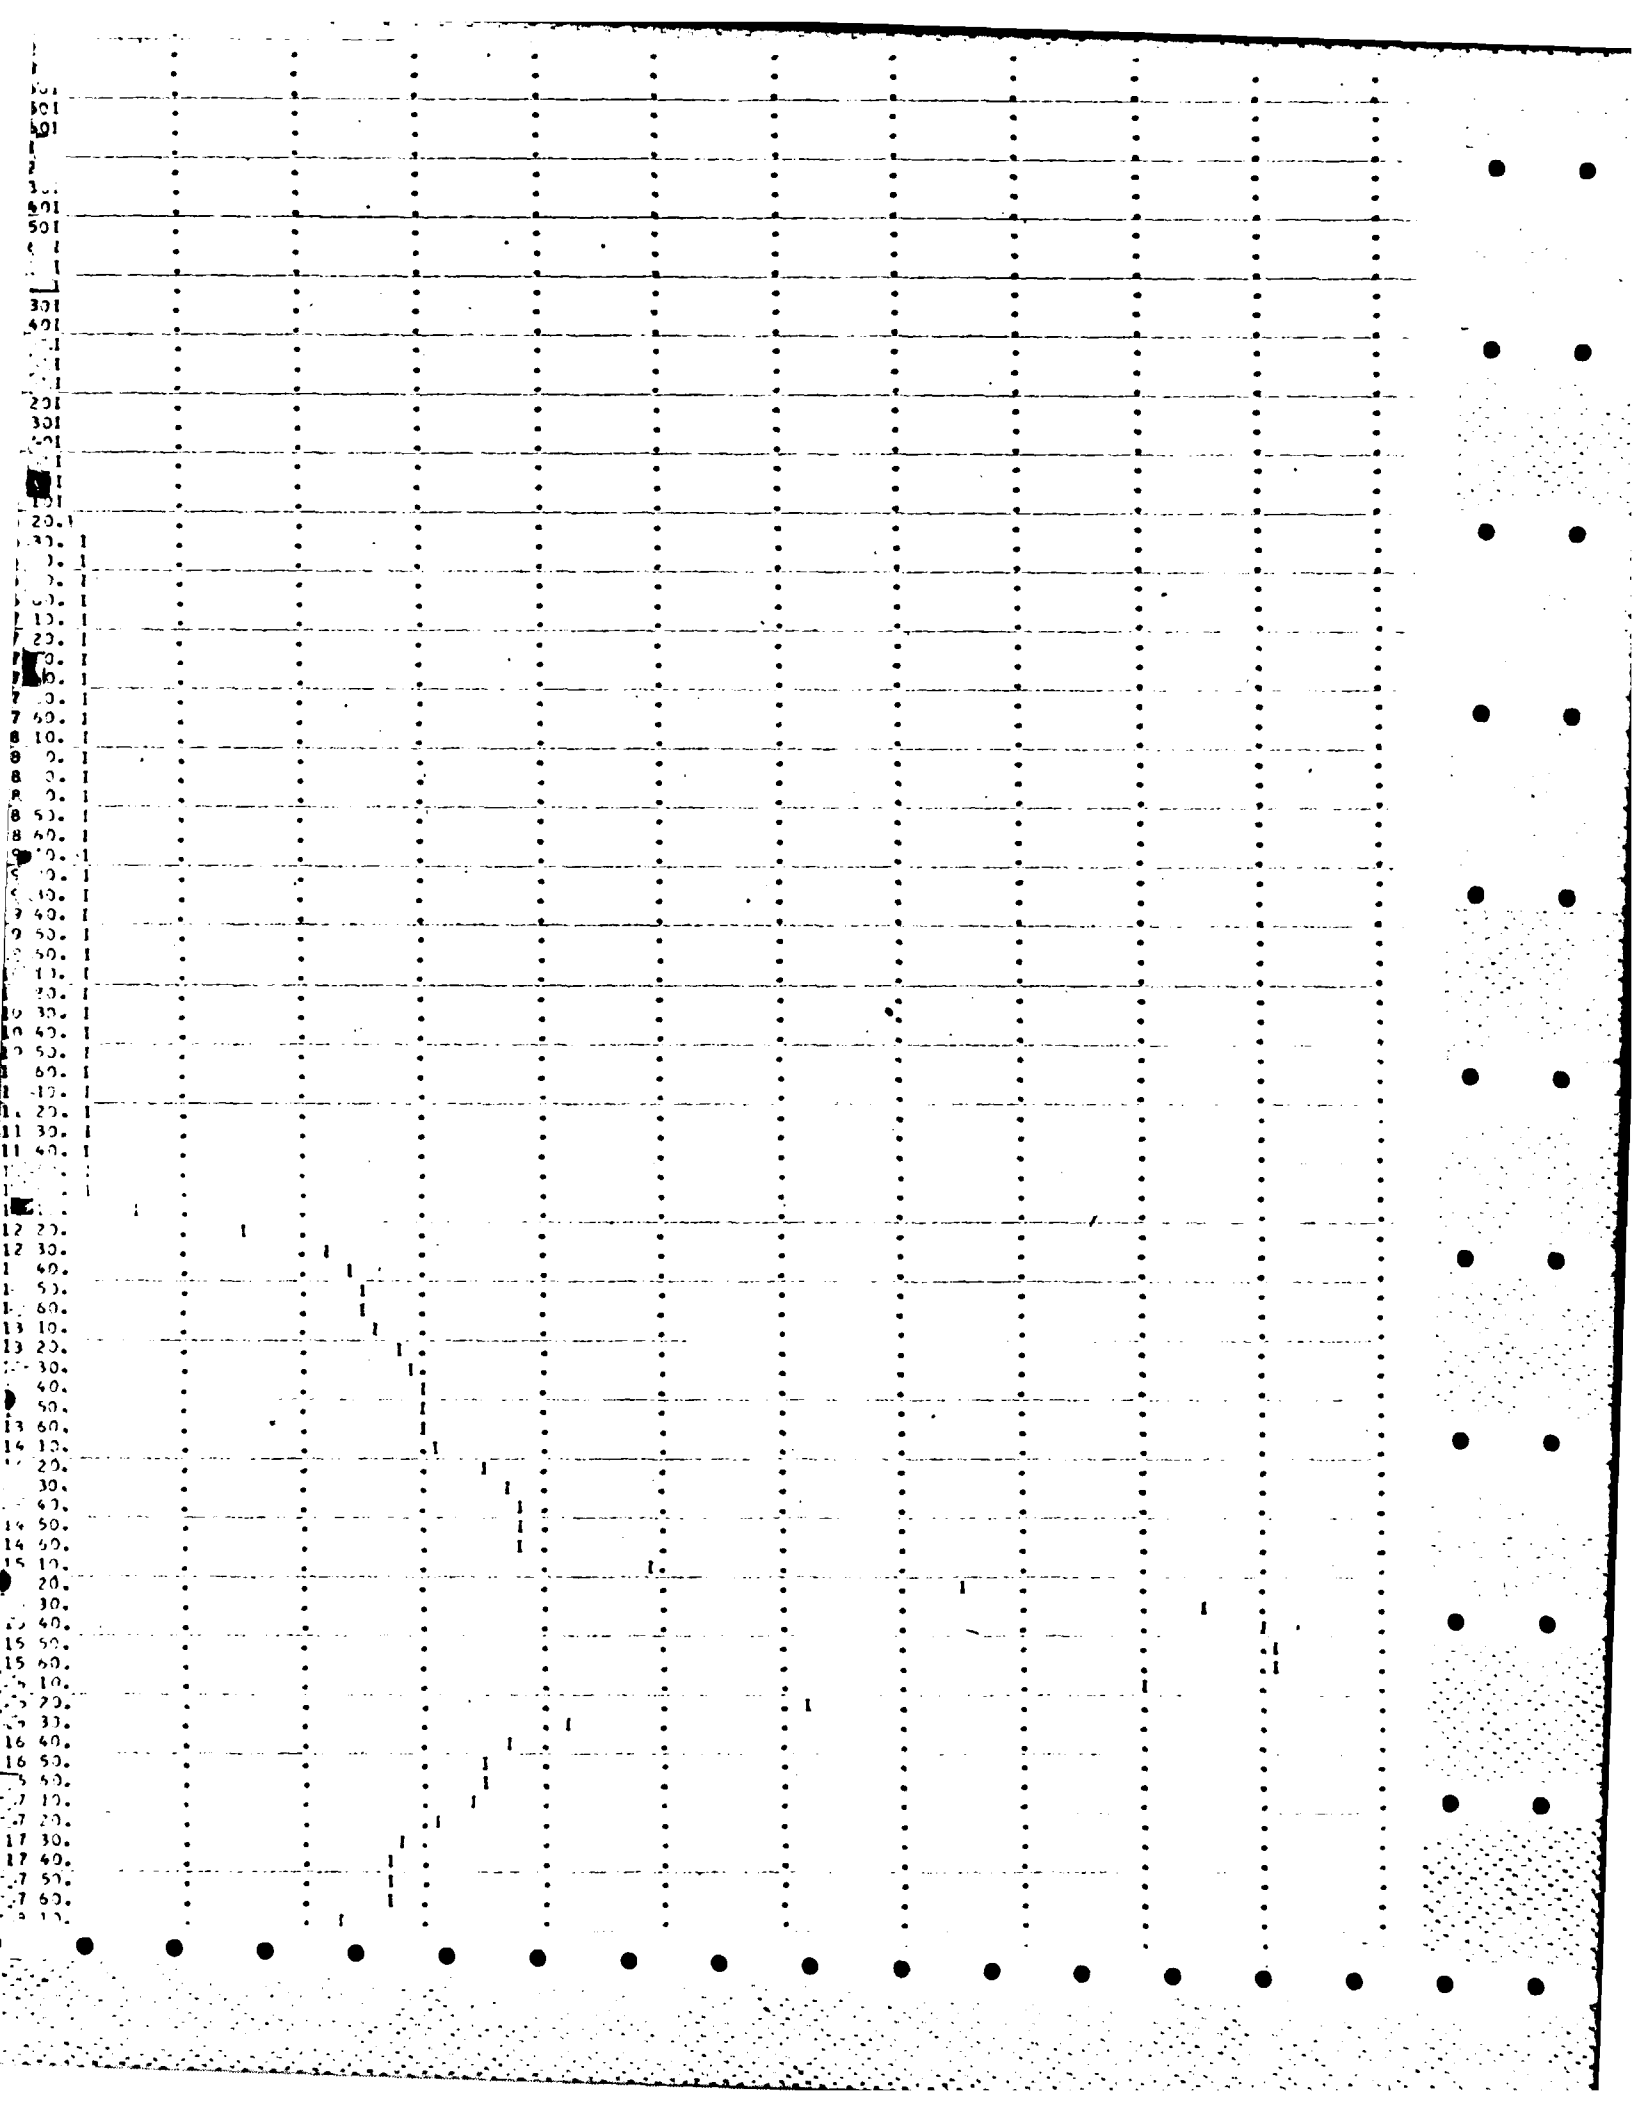

[illegible]

1STAC	1CDMP	1ECJN	1TAPR	JPRT	JPRT	INAME
1	1	0	0	0	0	1

CLASS	AVG	IRES	ISAME
0-0	0-0	1	0

NSTPS	NSTOL	LAG	AMSXX	X	TSK	STORA
1	0	0	0.0	0.0	0.0	-1.

STORAGE	15.	18.	20.	21.	23.	24.	26.	27.	28.	3.
CUTFLUND	2.	46.	88.	138.	192.	253.	318.	389.	419.	0.

TIME	CGP	STOR	AVG IN	EUP	OUT
0 10		15.	2.		2.
0 20		15.	2.		2.
0 30		15.	2.		2.
0 40		15.	2.		2.
0 50		15.	2.		2.
0 60		15.	2.		2.
1 10		15.	2.		2.
1 20		15.	2.		2.
1 30		15.	2.		2.
1 40		15.	2.		2.
1 50		15.	2.		2.
1 60		15.	2.		2.
2 10		15.	2.		2.
2 20		15.	1.		2.
2 30		15.	1.		2.
2 40		15.	1.		2.
2 50		15.	1.		2.
2 60		15.	1.		1.
3 10		15.	1.		1.
3 20		15.	1.		1.
3 30		15.	1.		1.
3 40		15.	1.		1.
3 50		15.	1.		1.
3 60		15.	1.		1.
4 10		15.	1.		1.
4 20		15.	1.		1.
4 30		15.	1.		1.
4 40		15.	1.		1.

[illegible]

1 9 40	15.	7.	7.
1 9 50	15.	7.	7.
1 9 60	15.	7.	7.
1 10 10	15.	7.	7.
1 10 20	15.	7.	7.
1 10 30	15.	7.	7.
1 10 40	15.	7.	7.
1 10 50	15.	7.	7.
1 10 60	15.	7.	7.
1 11 10	15.	7.	7.
1 11 20	15.	7.	7.
1 11 30	15.	7.	7.
1 11 40	15.	7.	7.
1 11 50	15.	7.	7.
1 11 60	15.	7.	7.
1 12 10	16.	15.	9.
1 12 20	16.	42.	15.
1 12 30	17.	75.	27.
1 12 40	18.	93.	39.
1 12 50	18.	98.	54.
1 12 60	19.	93.	68.
1 13 10	19.	170.	78.
1 13 20	19.	107.	88.
1 13 30	20.	115.	98.
1 13 40	20.	119.	105.
1 13 50	20.	120.	111.
1 13 60	20.	120.	114.
1 14 10	20.	123.	117.
1 14 20	21.	133.	123.
1 14 30	21.	145.	131.
1 14 40	21.	151.	138.
1 14 50	21.	152.	144.
1 14 60	21.	153.	148.
1 15 10	22.	175.	158.
1 15 20	23.	249.	195.
1 15 30	24.	341.	254.
1 15 40	26.	390.	319.
1 15 50	26.	402.	360.
1 15 60	27.	404.	381.
1 16 10	27.	381.	381.
1 16 20	26.	303.	343.
1 16 30	25.	208.	279.
1 16 40	23.	156.	224.
1 16 50	22.	144.	190.
1 16 60	22.	142.	170.
1 17 10	22.	139.	158.
1 17 20	21.	129.	146.
1 17 30	21.	117.	135.
1 17 40	21.	111.	126.
1 17 50	20.	109.	120.
1 17 60	20.	107.	116.
1 18 10	20.	100.	110.
1 18 20	20.	67.	94.
1 18 30	19.	42.	76.
1 18 40	19.	38.	64.
1 18 50	18.	37.	55.
1 18 60	18.	35.	49.
1 19 10	18.	34.	45.
1 19 20	18.	32.	42.
1 19 30	18.	31.	40.
1 19 40	18.	30.	38.
1 19 50	17.	29.	36.
1 19 60	17.	28.	35.
1 20 10	17.	27.	33.
1 20 20	17.	25.	32.
1 20 30	17.	24.	30.
1 20 40	17.	23.	27.
1 20 50	17.	23.	26.
1 20 60	17.	22.	27.
1 21 10	17.	21.	25.
1 21 20	17.	20.	24.
1 21 30	17.	19.	23.
1 21 40	16.	18.	22.
1 21 50	16.	18.	22.
1 21 60	16.	17.	21.
1 22 10	16.	16.	20.
1 22 20	16.	16.	19.
1 22 30	16.	15.	18.
1 22 40	16.	14.	18.
1 22 50	16.	14.	17.
1 22 60	16.	13.	16.
1 23 10	16.	13.	16.
1 23 20	16.	12.	15.
1 23 30	16.	12.	14.
1 23 40	16.	11.	14.
1 23 50	16.	11.	13.
1 23 60	16.	10.	13.

SUM


7140.

CFS	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
INCHES	381.	165.	50.	50.	7140.
AC-FT		9.00	10.85	10.85	10.85
		82.	94.	98.	98.

PYLOT SUMMARY, AVERAGE FLIGHT

	PEAK	6-10-75	24-4-75	72-10-75	ASSA
17-12-75 AT	1	52%	10%	50%	0-17
5-12-75	1	36%	10%	50%	0-17

1 23 50. 10
1 20 60. 10
1 21 10. 10
1 21 20. 10
1 21 30. 10
1 21 40. 1
1 21 50. 1
1 21 50. 10
1 22 10. 10
1 22 20. 10
1 22 30. 10
1 22 40. 10
1 22 50. 1
1 23 10. 1
1 23 20. 10
1 23 30. 10
1 23 40. 10
1 23 50. 10
1 23 60. 10

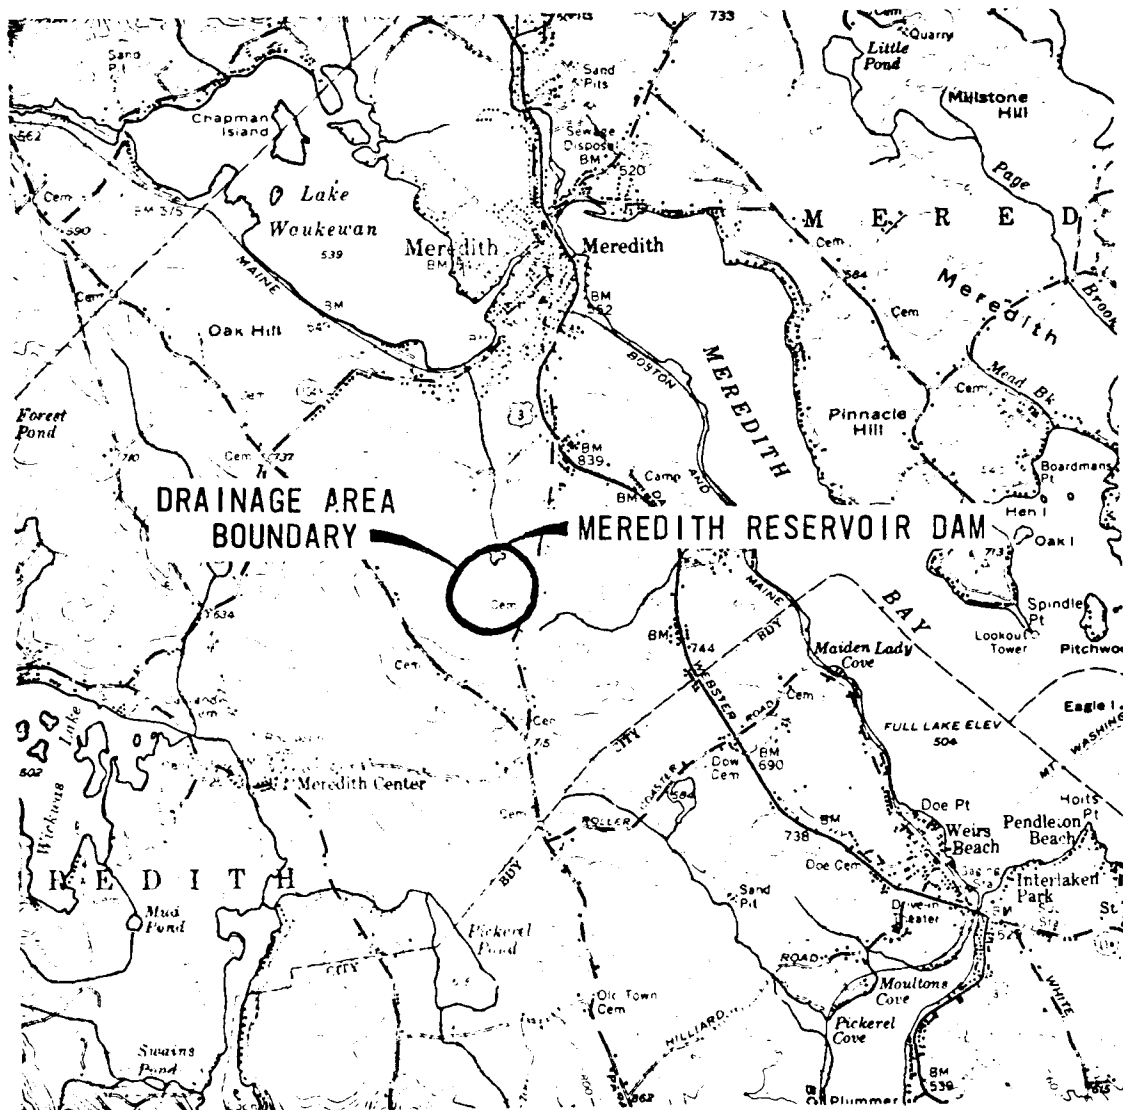

SOURCE OF MAP:
 U.S. GEOLOGICAL SURVEY
 HOLDERNESS & WINNIPESAUKEE
 QUADRANGLES
 NEW HAMPSHIRE
 SERIES V712
 1:62500 1956

DUFRESNE-HENRY ENGINEERING CORP.
 ARCHITECT-ENGINEER

U.S. ARMY ENGINEER DIV. NEW ENGLAND
 CORPS OF ENGINEERS
 WALTHAM, MASS.

NATIONAL PROGRAM OF INSPECTION OF NON-FED. DAMS

LOCATION MAP MEREDITH RESERVOIR DAM

MEREDITH

NEW HAMPSHIRE

CLIENT NO 04-0082

SCALE 1" = 1 MILE

ENGR JAD

DATE 3-14-79

APPENDIX E

Information as Contained in the National Inventory of Dams

END

FILMED

8-85

DTIC